

Keep This List

NL. 46 442 U

THIS CANCELS ALL PREVIOUS LISTS


**ILLUSTRATED
REPAIR PARTS LIST
FOR
MASSEY-HARRIS
No. 27 GANG PLOW
MOULDBOARD TYPE**

Tractor Drawn

--

2-Furrow

FIRST MANUFACTURED 1940

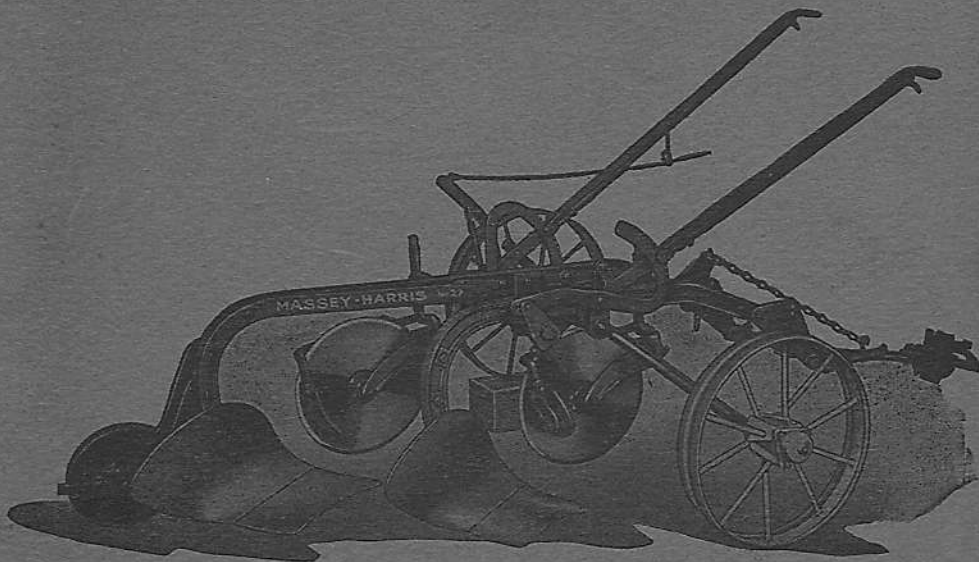

**A MONEY-SAVING SUGGESTION
FOR USERS OF REPAIR PARTS**

IT PAYS, in most instances, when a part is required for your machine to also replace the parts that work with it. This proves most economical and assures utmost value and efficiency from the new part, as old parts speedily wear out the newly replaced part and generally prevent it from performing its functions properly.

MASSEY-HARRIS COMPANY

Keep This List

NL. 46 442 U

**THIS CANCELS ALL PREVIOUS LISTS**

**ILLUSTRATED
REPAIR PARTS LIST**

FOR

MASSEY-HARRIS

No. 27 GANG PLOW

MOULDBOARD TYPE


Tractor Drawn




2-Furrow

FIRST MANUFACTURED 1940

MASSEY-HARRIS CO., Limited

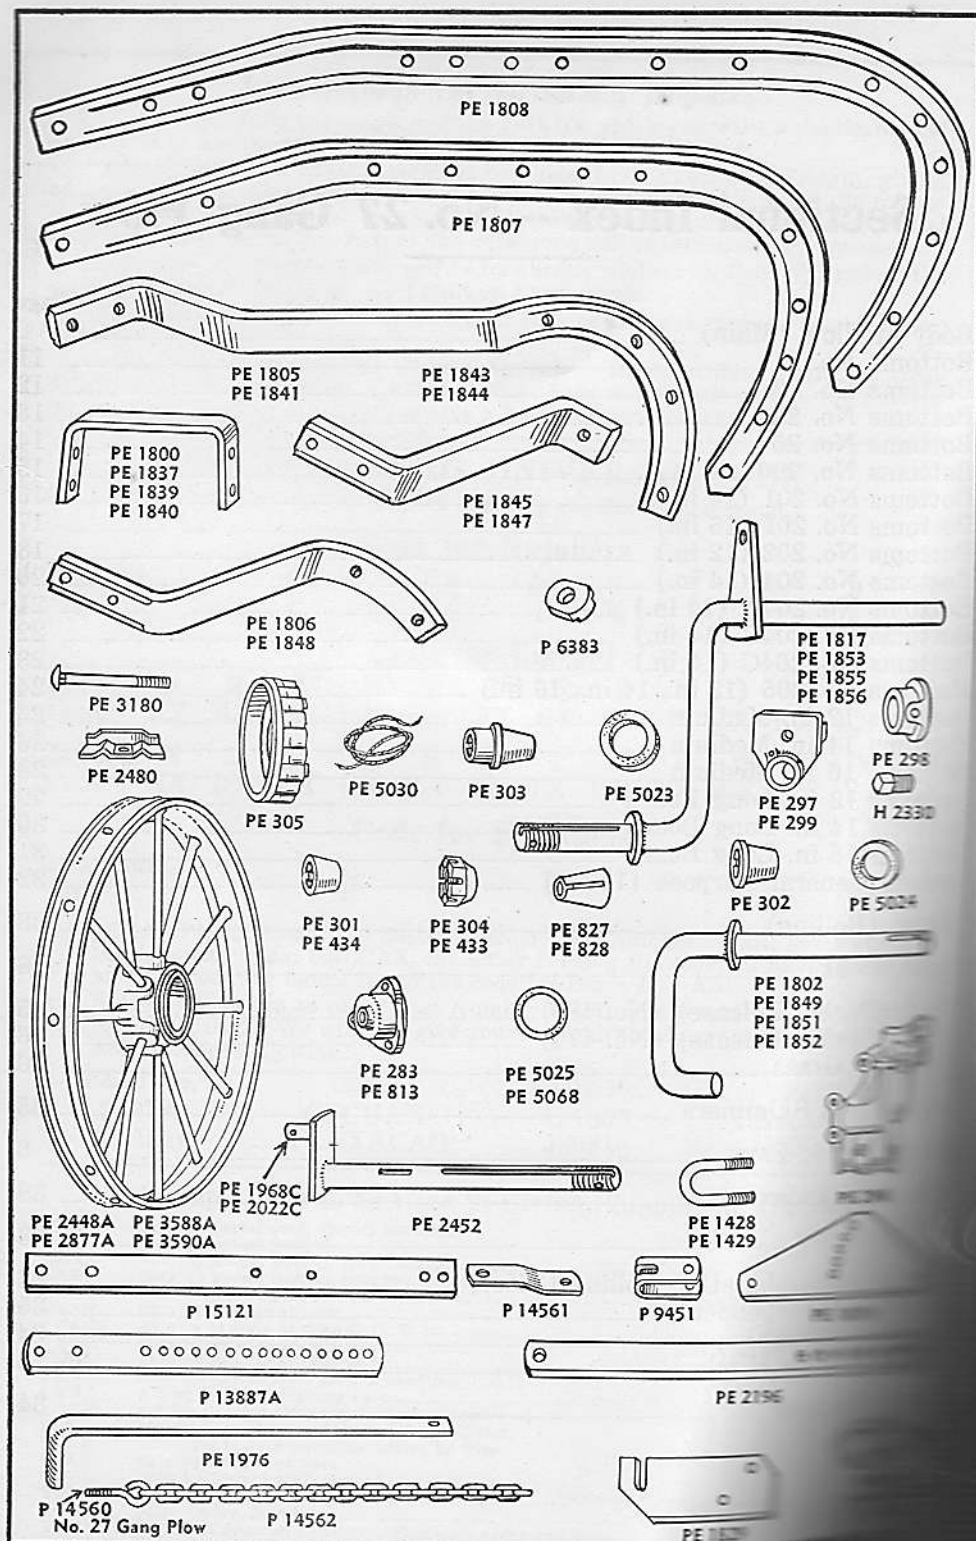

Do Not Order From Illustrations Only. Always Refer to
Plate Page No. 1

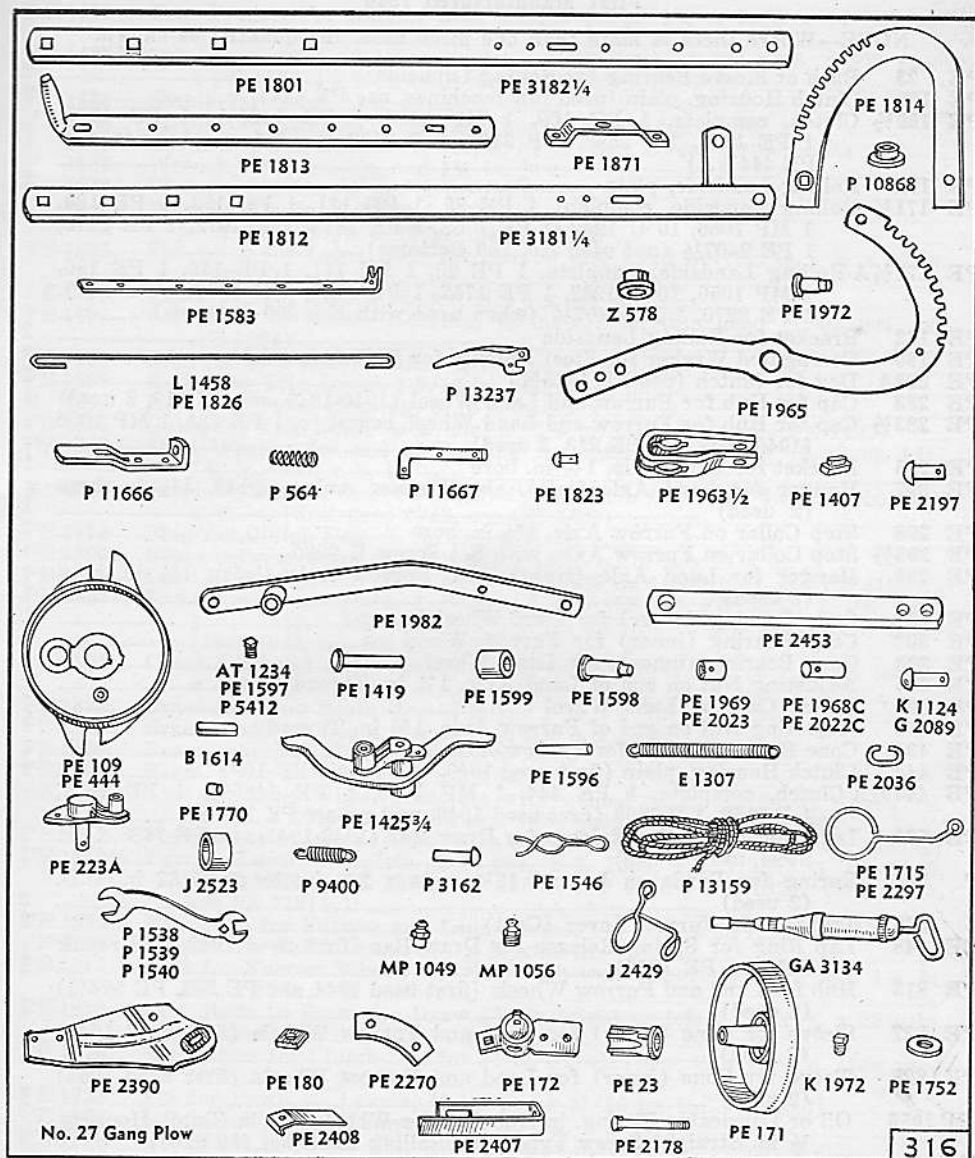

Do not order from illustrations only. Always refer to descriptive list.

MASSEY-HARRIS No. 27 GANG PLOW

LIST No.	DESCRIPTION OF PIECE	PLATE PAGE
First Manufactured 1940		
NOTE—Where there is more than one piece used, the quantity is shown.		
PE 23	Bush or Sleeve Bearing for Rolling Landside	2
PE 109	Clutch Housing, plain (used few machines, use PE 444)	2
PE 109½	Clutch, complete, 1 PE 109, 1 MP 1056, 1 PE 1425½, 1 PE 1597, 1 PE 1770, 1 J 2523, 1 P 3162, 1 P 9400 (used few machines, use PE 444½A)	
PE 171	Rolling Landside, plain	2
PE 171¼	Rolling Landside, complete, 1 PE 23, 1 PE 171, 1 PE 172, 1 PE 180, 1 MP 1056, 10 U 1262, 1 PE 1752, 1 PE 1833, 1 K 1972, 1 PE 2178, 1 PE 2407½ (not used No. 200 Bottoms)	
PE 171¼A	Rolling Landside, complete, 1 PE 23, 1 PE 171, 1 PE 172, 1 PE 180, 1 MP 1056, 10 U 1262, 1 PE 1752, 1 PE 1833, 1 K 1972, 1 PE 2178, 1 PE 2270, 1 PE 2407½ (when used with No. 200 Bottoms)	
PE 172	Bracket for Rolling Landside	2
PE 180	Corrugated Washer for Steel Bracket for Rolling Landside	2
PE 223A	Dog for Clutch (use PE 1425½)	2
PE 283	Cap for Hub for Furrow and Land Wheel (1940-1943, see PE 813, 2 used)	1
PE 283½	Cap for Hub for Furrow and Land Wheel, complete, 1 PE 283, 1 MP 1056 (1940-1943, see PE 813, 2 used)	
PE 296	Bracket for Land Axle, 1½ in. bore	1
PE 297	Hanger for Land Axle (left), also Furrow Axle (right), 1½ in. bore (2 used)	1
PE 298	Stop Collar on Furrow Axle, 1½ in. bore	1
PE 298½	Stop Collar on Furrow Axle, with Set Screw H 2330	
PE 299	Hanger for Land Axle (right), also Furrow Axle (left), 1½ in. bore (2 used)	1
PE 301	Cone Bearing (outer) for Land Wheel	1
PE 302	Cone Bearing (inner) for Furrow Wheel	1
PE 303	Cone Bearing (inner), for Land Wheel	1
PE 304	Adjusting Nut on end of Land Axle, 1½ in. Thread	1
PE 305	Clutch Case on Land Wheel	1
PE 433	Adjusting Nut on end of Furrow Axle, 1½ in. Thread	1
PE 434	Cone Bearing, outer, for Furrow Axle	1
PE 444	Clutch Housing, plain (first used 1940, will repair PE 109)	2
PE 444½A	Clutch, complete, 1 PE 444, 1 MP 1056, 1 PE 1425½, 1 PE 1597, 1 P 3162, 1 P 9400 (first used 1940, will repair PE 109½)	
PE 520	Lap Ring for Spring Release for Draw Bar (1940-1941, see PE 1888, Cast Steel, use PE 648)	1
P 564	Spring for Pawls on Levers, 12½ coils x 2¼ in. long, 25/32 in. O.D. (2 used)	2
Z 578	Trunnion in Furrow Lever (Cast)	2
PE 648	Lap Ring for Spring Release for Draw Bar (first used 1942, will repair PE 520, PE 1888)	1
PE 813	Hub for Land and Furrow Wheels (first used 1944, see PE 283, PE 283½) (2 used)	1
PE 827	Sleeve for Cone (outer) for Land and Furrow Wheels (first used 1944) (2 used)	1
PE 828	Sleeve for Cone (inner) for Land and Furrow Wheels (first used 1944) (2 used)	1
MP 1056	Oil or Lubricator Fitting, in Hub Cap for Wheels and in Clutch Housing, ½ in. Straight Screw Type, also Rolling Landside (10 used)	2
K 1124	Pin for Land Lever and Connection for Clutch Lift, ½ in. dia. x 1½ in. under Cotter (first used 1945, see G 2089)	2
AT 1234	Set Screw in Clutch Housing, ½ x 1¼ in. (first used 1943, see PE 1597)	
U 1262	Steel Washer for Adjusting Sleeve Bearing of Rolling Landside, 7/16 in. I.D., 13/16 in. O.D., thin (10 used)	
E 1307	Spring for Trip Lever, 7½ in. between hooks, 15/16 in. O.D., 49½ coils	2
PE 1407	Key for Arm on Crank for Land Axle, ½ x 1½ x 1 7/16 in. (1940 only)	2
PE 1419	Pivot Pin for Trip Lever, 1½ x 3¼ in.	2

**In Ordering Repair Parts. Always State the Accessory or Unit—
Also Machine Used On—It Helps**

MASSEY-HARRIS No. 27 GANG PLOW

LIST No.	DESCRIPTION OF PIECE	PLATE PAGE
PE 1425	Trip Finger, for Clutch, with welded parts, $2\frac{1}{4} \times 5/16 \times 14$ in. (use PE 1425 $\frac{3}{4}$)	
PE 1425 $\frac{3}{4}$	Trip Finger for Clutch, complete, 1 PE 223A, 1 PE 1425, 1 PE 1596, 1 PE 1770, 1 J 2523 (will repair PE 223A, PE 1425)	2
PE 1428	Staple for Land Axle Bracket, upper, $\frac{5}{8}$ in. dia. x 10 in.	1
PE 1429	Staple for Land Axle Bracket, lower, $\frac{5}{8}$ in. dia. x $8\frac{1}{4}$ in.	1
L 1458	Latch Rod for Furrow Lever, $3/16$ in. dia., 36 in. inside hooks	2
P 1538	Wrench, $11\frac{1}{2}$ in., $1\frac{1}{2}$ and $1\frac{1}{4}$ in. jaws	2
P 1539	Wrench, $9\frac{1}{2}$ in., $\frac{3}{4}$ and 1 in. jaws	2
P 1540	Wrench, 6 $\frac{5}{8}$ in., 9/16 and 11/16 in. jaws	2
PE 1546	Clip for Trip Rope, $3/16$ in. dia. x 15 in.	2
PE 1583	Extension for Latch Rods for Furrow and Land Levers, $\frac{1}{2} \times \frac{1}{8} \times 17$ in. (2 used)	2
PE 1596	Taper Pin for Clutch Finger, No. 6 x $1\frac{1}{4}$ in.	2
PE 1597	Set Screw in Clutch Housing, $\frac{1}{2}$ in. x 1 in. thin head (1940-1941, see AT 1234)	2
PE 1598	Stud for Trip Lever Roller, $\frac{3}{4}$ in. dia. x $2\frac{1}{16}$ in.	2
PE 1599	Roller for Trip Lever, $1\frac{7}{16}$ in. dia. x $1\frac{1}{2}$ in.	2
B 1614	Key for Clutch Housing, $5/16 \times 15/32 \times 1\frac{1}{4}$ in.	2
PE 1715	Guide for Trip Rope, $\frac{5}{8}$ in. dia. x $12\frac{1}{2}$ in. (1940-1944, see PE 2297)	2
PE 1752	Steel Washer for end of Bearing for Rolling Landside, $15/32$ in. I.D., $1\frac{1}{4}$ in. O.D. x $\frac{1}{8}$ in.	2
E 1755	Steel Washer on Sleeve for Lift Crank Stud, $1\frac{3}{16}$ in. I.D., $1\frac{1}{4}$ in. O.D. x $\frac{1}{8}$ in. (first used 1942, see GB 4430)	
PE 1770	Plug for Clutch Dog, $\frac{3}{8}$ in. dia. x $\frac{5}{8}$ in.	2
PE 1800	Brace between front of Beams (for 14 in.), $2 \times \frac{5}{8} \times 24\frac{1}{2}$ in.	1
PE 1801	Land Lever, lower section, $1\frac{1}{4} \times \frac{3}{4} \times 52\frac{1}{2}$ in. (1940-1941, see PE 3182 $\frac{1}{2}$)	2
PE 1801 $\frac{1}{2}$	Land Lever, complete, 1 P 564, 1 PE 1583, 1 PE 1801, 1 PE 1813, 1 PE 1823, 1 PE 1826, 1 PE 1871, 1 P 11666, 1 P 11667, 1 P 13237 (1940-1941, use PE 3182 $\frac{1}{2}$)	
PE 1802	Crank for Land Axle, complete with welded parts (for 14 in.), $1\frac{1}{2}$ in. dia. x $40\frac{1}{4}$ in.	1
PE 1805	Brace for Long Beam (for 14 in.), $2 \times \frac{7}{8} \times 54$ in.	1
PE 1806	Brace for Short Beam (for 14 in.), $2 \times \frac{7}{8} \times 32$ in.	1
PE 1807	Beam (short or No. 1), $2\frac{3}{4} \times 2 \times 72$ in.	1
PE 1808	Beam (long or No. 2), $2\frac{3}{4} \times 2 \times 93$ in.	1
PE 1809	Axle for Land Wheel, complete with welded parts, for 24 in. wheel, $1\frac{1}{2}$ in. dia. x $16\frac{1}{8}$ in., $5\frac{1}{4}$ in. arm (few used 1939, use PE 2452)	
PE 1812	Furrow Lever, lower section with welded parts (1940-1941, see PE 3181 $\frac{1}{4}$)	2
PE 1812 $\frac{1}{2}$	Furrow Lever, complete, 1 P 564, 1 L 1458, 1 PE 1812, 1 PE 1813, 1 PE 1823, 1 PE 1583, 1 P 11666, 1 P 11667, 1 P 13237 (1940-1941, use PE 3181 $\frac{1}{2}$)	
PE 1813	Extension for Furrow and Land Levers, $1\frac{1}{2} \times \frac{3}{8} \times 35$ in. (2 used)	2
PE 1814	Ratchet for Land Lever, $1\frac{1}{2} \times \frac{3}{8} \times 29$ in.	2
PE 1817	Axle for Furrow Wheel, complete with welded parts (for 14 in.), $1\frac{1}{2}$ in. dia. x 50 in., $1\frac{1}{2}$ in. thread	1
PE 1819	Jaw, Bolts to Beam for Draw Clevis (right or left), $5\frac{1}{4} \times \frac{3}{8} \times 22\frac{1}{2}$ in. (2 used)	1
PE 1820	Connection for Clutch Lift for 24 in. wheel, $1\frac{1}{2} \times \frac{1}{2} \times 17\frac{1}{2}$ in. (few used 1939, see PE 2453)	
PE 1823	Pin for Pawls on Levers, $\frac{1}{4}$ in. dia. x $11/16$ in. U.C. (2 used)	2
PE 1826	Latch Rod for Land Lever, $3/16$ in. dia. x 43 in.	2
PE 1829	Grab Post for Hitch Chain, $4 \times \frac{3}{8} \times 18$ in.	1
PE 1833	Steel Bracket for Rolling Landside, $7 \times \frac{3}{8} \times 17\frac{1}{4}$ in. (few used, use PE 2390)	
PE 1837	Brace between front of Beams (for 10 in.), $2 \times \frac{5}{8} \times 20\frac{1}{2}$ in.	1
PE 1839	Brace between front of Beams (for 12 in.), $2 \times \frac{5}{8} \times 22\frac{1}{2}$ in.	1
PE 1840	Brace between front of Beams (for 16 in.), $2 \times \frac{5}{8} \times 26\frac{1}{2}$ in.	1
PE 1841	Brace for Long Beam (for 10 in.), $2 \times \frac{7}{8} \times 50$ in.	1
PE 1843	Brace for Long Beam (for 12 in.), $2 \times \frac{7}{8} \times 52$ in.	1
PE 1844	Brace for Long Beam (for 16 in.), $2 \times \frac{7}{8} \times 56$ in.	1
PE 1845	Brace for Short Beam (for 10 in.), $2 \times \frac{7}{8} \times 28$ in.	1
PE 1847	Brace for Short Beam (for 12 in.), $2 \times \frac{7}{8} \times 30$ in.	1

Use Only Genuine Massey-Harris Repair Parts

MASSEY-HARRIS No. 27 GANG PLOW

LIST No.	DESCRIPTION OF PIECE	PLATE PAGE
PE 1848	Brace for Short Beam (for 16 in.), 2 x 7/8 x 36 in.	1
PE 1849	Crank for Land Axle, with welded parts (for 10 in.), 1 1/2 in. dia. x 36 3/4 in.	1
PE 1851	Crank for Land Axle, with welded parts (for 12 in.), 1 1/2 in. dia. x 38 3/4 in.	1
PE 1852	Crank for Land Axle, with welded parts (for 16 in.), 1 1/2 in. dia. x 42 3/4 in.	1
PE 1853	Axle for Furrow Wheel, with welded parts (for 10 in.), 1 1/2 in. dia. x 46 in., 1 1/2 in. thread	1
PE 1855	Axle for Furrow Wheel, with welded parts (for 12 in.), 1 1/2 in. dia. x 48 in., 1 1/2 in. thread	1
PE 1856	Axle for Furrow Wheel, with welded parts (for 16 in.), 1 1/2 in. dia. x 52 in., 1 1/2 in. thread	1
PE 1871	Hammerstrap for Land Lever, 1 1/4 x 1/4 x 7 3/4 in. (1940-1941, see PE 3184, PE 3367)	2
PE 1887	Spring Release for Draw Bar (Holland Hitch No. 480) (1940 only, see PE 2529)	
PE 1887 1/2	Spring Release for Draw Bar, complete, 1 PE 1887 and 1 PE 1888, 1940 only (see PE 2529 1/2)	
PE 1888	Lap Ring for Spring Release for Draw Bar (1940 only, use PE 648)	
PE 1963 1/2	Arm on Crank for Land Axle for Furrow Lever Ratchet, with Key welded in	2
PE 1965	Ratchet for Furrow Lever, 1 3/4 x 3/8 x 34 in.	2
PE 1968C	Stud in Land Axle, 13/16 in. dia. x 1 3/8 in. (welded), (1940-1941, see PE 2022C)	2
PE 1969	Sleeve for Stud on Lift Crank, 3/4 in. dia. x 1 in. (1940-1941, see PE 2023)	2
K 1972	Set Screw in Bracket for Rolling Landside, 1/2 in. dia. x 3/4 in.	2
PE 1972	Pin or Rivet from Furrow Ratchet to Lever, 3/4 in. dia. x 7/8 in.	2
PE 1976	Lift Handle for Hitch, 1 1/8 x 1/4 x 24 1/2 in., Handle to end	1
PE 1981	Steel Washer on inside end of Stud, in Axle for Land Wheel, 27/32 in. I.D., 1 1/2 in. O.D. x 1/16 in.	
PE 1982	Trip Lever, plain, 1 1/2 x 7/16 x 23 1/2 in.	2
PE 1982 1/2	Trip Lever, complete, 1 MP 1056, 1 PE 1589, 1 PE 1599, 1 PE 1982	
PE 2022C	Stud in Land Axle, 13/16 in. dia., 1 1/2 in. (welded), first used 1941 (see PE 1968C)	1-2
PE 2023	Sleeve for Stud on Lift Crank, 3/4 in. pipe x 1 1/8 in., first used 1941 (see PE 1969)	2
PE 2036	Link for Trip Spring, 5/16 in. dia. x 4 7/16 in.	2
G 2089	Pin for Land Lever and Connection for Clutch Lift, 5/8 in. dia. x 1 3/16 in. U.C. (1940-1944, see K 1124)	2
PE 2178	Bolt for Rolling Landside, 7/16 in. dia. x 4 1/4 in., No. 3 Hd., L.H. Thread	2
Y 2181	Steel Washer next to Nut on Land Axle, 1 17/32 in. I.D., 2 3/16 in. O.D. x 1/16 in. (first used 1941, 2 used)	
PE 2189	Land Wheel, 4 x 24 in., complete, 1 PE 283, 1 PE 301, 1 PE 303, 1 PE 305, 1 MP 1056, 1 PE 2189A, 3 PE 2194, 1 PE 5023, 1 PE 5025, 1 PE 5030 (few used 1939, use PE 3588)	
PE 2189 1/2	Land Wheel, 4 x 24 in., complete, 1 PE 2189, 10 PE 2195 1/2 (few used 1939, use PE 3588 1/2)	
PE 2189A	Wheel for Land or Furrow, 4 x 24 in., with Rim Spokes and Hub (few used 1939, see PE 2448A, PE 2877A, PE 3588A, 2 used)	
PE 2190	Furrow Wheel, 4 x 24 in., complete, 1 PE 283, 1 PE 301, 1 PE 302, 1 MP 1056, 1 PE 2189A, 1 PE 5023, 1 PE 5024, 1 PE 5025 (few used 1939, use PE 3589)	
PE 2194	Bolt for Land Hub and Clutch Ring, 5/8 in. dia. x 6 3/4 in., No. 3 Head (few used 1939, see PE 2379, 3 used)	
PE 2196	Brace for Draw Bar, 1 3/4 x 1/2 x 26 3/8 in.	1
PE 2197	Pin for Furrow Lever Ratchet and Arm, 5/8 in. dia. x 1 1/16 in. U.C.	2
PE 2270	Shim between Beam and Bracket for Rolling Landside, 3 1/2 x 1/4 x 8 3/4 in. (used with No. 200 Bottom)	2
PE 2297	Guide for Trip Rope, 5/8 in. dia. x 27 1/4 in. (first used 1945, see PE 1715)	2
H 2330	Set Screw in Stop Collar on Furrow Axle, 1/2 in. dia. x 1 in.	1
PE 2379	Bolt for Land Wheel Hub, and Clutch Ring, 3/4 x 6 1/2 in. Carriage Head, long thread (1940-1945, see PE 2194, use PE 3180) (3 used)	1
PE 2390	Bracket for Rolling Landside (will repair PE 1833), 6 3/4 x 3/8 x 19 1/4 in.	2
PE 2407	Arm for Scraper for Rolling Landside, 1 x 1/4 x 14 1/4 in.	2

NOTE—The word "Welded" means the part so described is WELDED to some other part or parts, and should not be ordered only as needed.

MASSEY-HARRIS No. 27 GANG PLOW

LIST No.	DESCRIPTION OF PIECE	PLATE PAGE
PE 2407½	Scraper for Rolling Landside, complete, 1 PE 2407, 1 PE 2408	
PE 2408	Blade for Scraper for Rolling Landside, 1½ x ¾ x 3½ in.	2
J 2429	Holder for Lubricator or Grease Gun	2
PE 2448	Land Wheel, 4 x 26 in., complete, 1 PE 283, 1 PE 305, 1 MP 1056, 3 PE 2379, 1 PE 2448A, 1 PE 5023, 1 PE 5025 (1940-1944, use PE 3588)	
PE 2448½	Land Wheel, 4 x 26 in., complete, 10 PE 2480½, 1 PE 2448 (1940-1944, use PE 3588½)	
PE 2448A	Wheel, 4 x 26 in., for Land and Furrow, with Rim Spokes and Hub (1940-1944, see PE 2189A, PE 2877A, PE 3588A, 2 used)	1
PE 2449	Furrow Wheel, 4 x 26 in., complete, 1 PE 283, 1 MP 1056, 1 PE 2448A, 1 PE 5023, 1 PE 5025 (1940-1944, use PE 3589)	
PE 2452	Axle for Land Wheel, with welded parts, for 26 in. wheel, 1½ in. dia. x 16½ in., 5½ in. arms (first used 1940, will repair PE 1809)	1
PE 2453	Connection for Clutch Lift (for 26 in. wheel), 1½ x ½ x 18½ in. (first used 1940, see PE 1820)	2
PE 2480	Lug for Land Wheel, 1¾ x ¾ x 3/16 x 4 in. (10 used)	1
PE 2480½	Lug for Land Wheel, complete with 7/16 in. dia. x 1 in., Machine Bolts (10 used)	
J 2523	Roller for Clutch Finger, 1½ in. dia. x 1 in.	2
PE 2529	Spring Release for Draw Bar, plain (Holland Hitch No. 470) (first used 1940, see PE 1887)	
PE 2529¼	Spring Release for Draw Bar, complete, 1 PE 648, 1 PE 2529 (first used 1942, will repair PE 2529¾)	
PE 2529¾	Spring Release for Draw Bar, complete, 1 PE 520, 1 PE 2529 (1940-1941, see PE 1887½, use PE 2529¼)	
PE 2877A	Wheel for Land and Furrow, with Rim Spokes and Hub, 6 in. face, 26 in. dia. (1941-1944, see PE 2448A, PE 3590A) (2 used)	1
GA 3134	Lubricator or Grease Gun (see page 24)	2
P 3162	Rivet for Spring in Clutch, 5/16 in. dia. x 1½ in. Rd. Hd.	2
PE 3180	Bolt for Land Wheel Hub and Clutch Ring, ¾ in. dia. x 8 in. Cge. Hd. (first used 1946, will repair PE 2379) (3 used)	1
PE 3181¼	Furrow Lever with welded parts (first used 1942, see PE 1812)	2
PE 3181½	Furrow Lever, complete, P 564, PE 1583, PE 1823, PE 1826, PE 3181¼, P 11667, P 12327 (first used 1942, will repair PE 1812½)	
PE 3182¼	Land Lever with welded parts (first used 1942, see PE 1801)	2
PE 3182½	Land Lever, complete, P 564, PE 1583, PE 1823, PE 3182¼, P 11667, P 12327 (first used 1942, will repair PE 1801½)	
PE 3183	Keeper for Land and Furrow Levers (welded) (1942-1944, see PE 3253, P 11666) (2 used)	
PE 3184	Hammerstrap for Land Lever (welded), 1¼ x ¼ x 5½ in. (1942-1943, see PE 1871, PE 3367)	
PE 3253	Keeper for Land and Furrow Levers, 1¼ x ¼ x 6½ in. bend to end (welded) (first used 1945, see PE 3183) (2 used)	
PE 3367	Brace for Land Lever, 1¼ x ¼ x 31½ in. (welded) (first used 1944, see PE 3184)	
PE 3368	Brace for Furrow Lever, 1¼ x ¼ x 24½ in. (welded) (first used 1944)	
PE 3369	Spacer for Land and Furrow Levers (welded) (first used 1944, 2 used)	
PE 3588	Land Wheel (4 x 26 in. Sleeve Type), complete, PE 305, PE 813, PE 827, PE 828, 3 PE 2379, PE 3588A, PE 5023, PE 5025 (first used 1945, will repair PE 2189 and PE 2448)	
PE 3588A	Wheel for Land and Furrow (Sleeve Type 4 x 26 in.), with Rim, Spokes and Hub (first used 1945, see PE 2877A, 2 used)	1
PE 3588½	Land Wheel (4 x 26 in. Sleeve Type), complete, 10 PE 2480, 1 PE 3588A (first used 1945, will repair PE 2189½ and PE 2448½)	
PE 3589	Furrow Wheel (4 x 26 in. Sleeve Type), complete, PE 813, PE 827, PE 828, PE 3588A, PE 5023, PE 5025 (first used 1945, will repair PE 2190 and PE 2449)	
PE 3590A	Wheel for Land and Furrow (6 x 26 in. Sleeve Type) with Rim, Spokes and Hub (first used 1945, see PE 2448A, 2 used)	1
J 3593	Steel Washer next to Nut on Furrow Axle, 1 13/32 in. I.D., 2 in. O.D. x 1/16 in. (first used 1941)	


In Ordering Repair Parts, Always State the Accessory or Unit—
Also Machine Used On—It Helps

MASSEY-HARRIS No. 27 GANG PLOW

LIST No.	DESCRIPTION OF PIECE	PLATE PAGE
GB 4430	Steel Washer on Sleeve for Lift Crank Stud, 1 3/32 in. I.D., 1 23/32 in. O.D. x 1/16 in. (1940-1941, see E 1755)	
PE 5023	Felt Washer between Cone and Hub, Land and Furrow Wheels, 3 3/8 in. O.D. x 2 1/2 in. I.D. x 3/8 in. (2 used)	1
PE 5024	Felt Washer in Furrow Wheel between Inside Cap and Washer on Axle, 2 in. O.D. x 1 1/2 in. I.D. x 5/16 in.	1
PE 5025	Paper Washer inside Hub Cap, Furrow and Land Wheels, 3 3/8 in. O.D. x 2 3/8 in. I.D. x 1/32 in. (1940-1945, see PE 5068) (2 used)	1
PE 5030	Packing Cord for Land Wheel next to Clutch Housing, 10 in. long	1
PE 5068	Paper Washer inside Hub Cap of Furrow and Land Wheels, 3 3/8 in. O.D. x 2 3/8 in. I.D. x 1/32 in. (first used 1946, see PE 5025) (2 used)	
P 5412	Set Screw in Land Axle Bracket for Pivot Pin for Trip Lever, 7/16 in. dia. x 5/8 in.	2
P 6383	Washer between Land Ratchet and Beam (Cast, 3 used)	1
P 9400	Spring for Clutch, 1 1/32 in. between hooks, 12 1/2 coils, 3/4 in. O.D.	2
P 9451	Slotted Clevis for Draw Bar, 2 1/4 x 3/8 x 8 5/8 in. (2 used)	1
P 10868	Trunnion for Land Lever (Cast)	2
P 11666	Keeper for Land and Furrow Levers, 1 1/2 x 1/4 x 5 3/4 in. (1940-1941, see PE 3183) (2 used)	
P 11667	Plunger for Furrow and Land Levers, 1/2 x 5/16 x 6 3/8 in. (2 used)	2
P 13159	Rope for Clutch Trip, 5/16 in. dia. x 120 in.	2
P 13237	Hand Latch for Land and Furrow Levers (Cast, 2 used)	2
P 13887A	Cross Draw Bar, 2 1/2 x 1/2 x 21 1/2 in. (17 holes)	1
P 14560	Eyebolt for Draw Chain, 5/8 in. dia. x 4 in.	
P 14561	Hammerstrap for Draw Bar, 1 1/2 x 5/16 x 7 in.	1
P 14562	Draw Chain, complete, 1 P 14560, 1 P 14562A	1
P 14562A	Draw Chain (23 links), 5/16 in., welded chain	
P 15121	Draw Bar, 2 1/2 x 3/8 x 26 in. (6 holes)	1

Use Only Genuine Massey-Harris Repair Parts

MASSEY-HARRIS No. 27 GANG PLOW

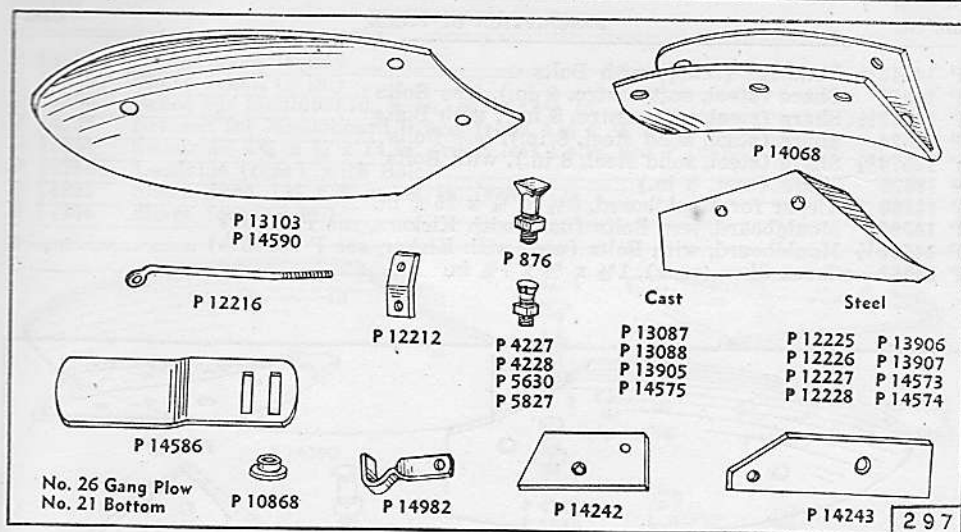


No. 21 BOTTOM

List No.	DESCRIPTION OF PIECE	Quantity Used
P 876	Plow Bolt for (Cast) Shares, 7/16 in. dia. x 1 1/4 in. Left Hand Thread, No. 4 Head (see P 4228)	4
P 1156	Washer on Beams, lower, 5/16 x 1 1/2 in. square (Steel)	2
P 4227	Plow Bolt, Mouldboard to Head, Brace to Mouldboard and Landside to Head, No. 7, 7/16 x 1 1/4 in.	8
P 4228	Plow Bolt (Steel) Share to Head, No. 7, Left Hand Thread, 7/16 x 1 1/4 in. (see P 876)	4
P 5630	Plow Bolt, Landside, Head and Beam, No. 7, 5/8 x 2 1/2 in.	2
P 12226 1/2	Share (steel, 10 1/2 in., solid steel), with Bolts x 3 3/4 in., No. 7	2
P 10868	Thimble for Shock Shoe (Cast)	2
P 12212	Bracket for Mouldboard Brace, front, 1 3/4 x 1/2 x 5 1/2 in.	1
P 12216	Brace for Mouldboard, 5/8 in. dia. x 13 1/2 in.	2
P 12225	Share (steel, 10 1/2 in., soft centre), less Bolts	2
P 12225 1/2	Share (steel, 10 1/2 in., soft centre), with Bolts	2
P 12226	Share (steel, 10 1/2 in., solid steel), less Bolts	2
P 12226 1/2	Share (steel, 10 1/2 in., solid steel), with Bolts	2
P 12227	Share (steel, 12 in., soft centre), less Bolts	2
P 12227 1/2	Share (steel, 12 in., soft centre), with Bolts	2
P 12228	Share (steel, 12 in., solid steel), less Bolts	2
P 12228 1/2	Share (steel, 12 in., solid steel), with Bolts	2
P 13087	Share (cast, 10 1/2 in.)	2
P 13088	Share (cast, 12 in.)	2
P 13103	Mouldboard, less Bolts (not used with Kickers, see P 14590)	2
P 13103 1/2	Mouldboard, with Bolts (not used with Kicker, see P 14590 1/2)	2
P 13905	Share (cast, 9 in.)	2
P 13906	Share (steel, 9 in., soft centre), less Bolts	2
P 13906 1/2	Share (steel, 9 in., soft centre), with Bolts	2
P 13907	Share (steel, 9 in., solid steel), less Bolts	2
P 13907 1/2	Share (steel, 9 in., solid steel), with Bolts	2
P 14068	Head for Mouldboard and Share	2
P 14242	Landside (front), 3 3/4 x 3/8 x 7 3/4 in., less Bolts	1
P 14242 1/2	Landside (front), with Bolts	1
P 14243	Landside (rear), 3 3/4 x 3/8 x 12 1/2 in., less Bolts	1

NOTE—The word "Welded" means the part so described is WELDED to some other part or parts, and should not be ordered only as needed.

MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
P 14243½	Landside (rear), with Bolts	1
P 14573	Share (steel, soft centre, 8 in.), less Bolts	2
P 14573½	Share (steel, soft centre, 8 in.), with Bolts	2
P 14574	Share (steel, solid steel, 8 in.), less Bolts	2
P 14574½	Share (steel, solid steel, 8 in.), with Bolts	2
P 14575	Share (cast, 8 in.)	2
P 14586	Kicker for Mouldboard, 3½ x ¼ x 15¼ in.	2
P 14590	Mouldboard, less Bolts (used with Kickers, see P 13103)	2
P 14590½	Mouldboard, with Bolts (used with Kicker, see P 13103½)	2
P 14982	Shock Shoe (rear), 1½ x ¾ x 7¾ in.	1

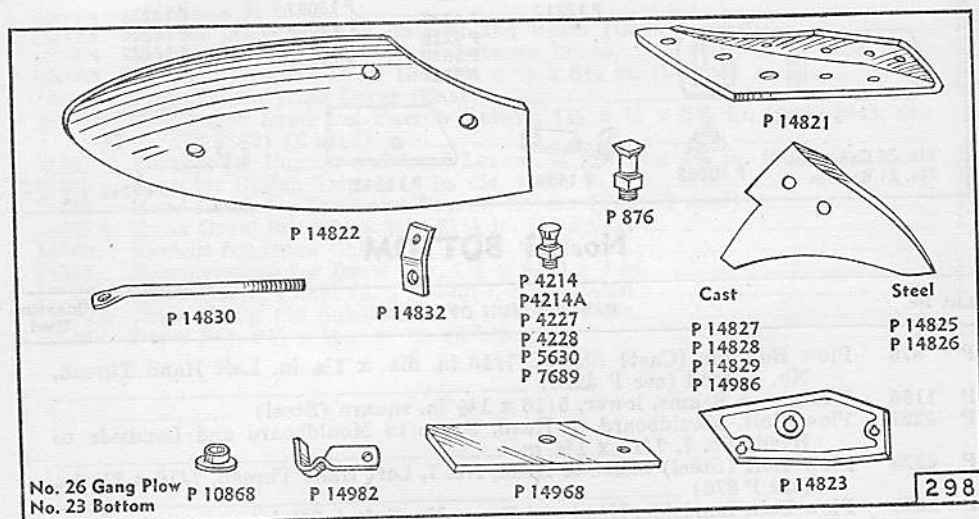


No. 23 BOTTOMS

		Quantity Used
P 876	Plow Bolt for (Cast) Shares, 7/16 in. dia. x 1¼ in. L.H. Thread, No. 4 Head (see P 4228)	4
P 1156	Washer on Beams (lower), 5/16 x 1½ in. square (steel)	2
P 4214	Plow Bolt, Mouldboard to Brace and Mouldboard to Head, No. 7, ¾ x 1 in.	2
P 4214A	Plow Bolt, Mouldboard to Head, No. 7, ¾ x 1½ in.	4
P 4227	Plow Bolt, Landside to Head, No. 7, 7/16 x 1¼ in.	4
P 4228	Plow Bolt (Steel) Share to Head, No. 7, 7/16 x 1¼ in., Left Hand Thread (see P 876)	4
P 5630	Plow Bolt, Landside to Head and Beam, No. 7, ¾ x 2½ in.	2
P 7689	Plow Bolt, Landside, Head, Beam and for Shock Shoe, ¾ in. dia. x 3½ in., No. 7	1
P 10868	Thimble for Shock Shoe (cast)	1
P 14821	Head for Mouldboard and Share	2
P 14822	Mouldboard, less Bolts	2
P 14822½	Mouldboard, with Bolts	2
P 14823	Landside (front, cast, see P 14968)	1
P 14825	Share (steel, soft centre, 7 in.), less Bolts	2
P 14825½	Share (steel, soft centre, 7 in.), with Bolts	2
P 14826	Share (steel, solid steel, 7 in.), less Bolts	2
P 14826½	Share (steel, solid steel, 7 in.), with Bolts	2
P 14827	Share (cast, 7 in.)	2

**In Ordering Repair Parts, Always State the Accessory or Unit—
Also Machine Used On—It Helps**

MASSEY-HARRIS No. 27 GANG PLOW


List No.	DESCRIPTION OF PIECE	Quantity Used
P 14828	Share (cast, 8 in.)	2
P 14829	Share (cast, 10 in.)	2
P 14830	Brace for Mouldboard, $\frac{5}{8}$ in. rd. x $12\frac{1}{2}$ in.	2
P 14832	Bracket for Mouldboard Brace, front, $1\frac{1}{2}$ x $\frac{1}{2}$ x $5\frac{1}{2}$ in.	2
P 14968	Landside, $4\frac{3}{4}$ x $\frac{3}{8}$ x 14 in. (rear, less Bolts, see P 14823)	1
P 14968 $\frac{1}{2}$	Landside (rear), with Bolts	1
P 14982	Shock Shoe, $1\frac{1}{2}$ x $\frac{3}{8}$ x $7\frac{3}{4}$ in. (rear)	1
P 14986	Share (cast, 9 in.)	2

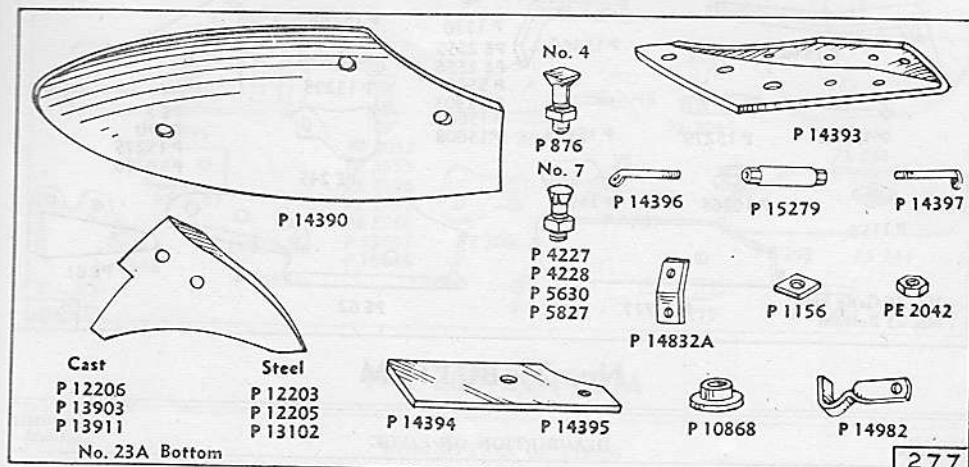

No. 23A BOTTOMS

		Quantity Used
P 876	Plow Bolt for Cast Share to Head, $\frac{7}{16}$ in. dia. x $1\frac{1}{4}$ in., Left Hand Thread, No. 4 Head	2
P 1156	Steel Washer on Beams (lower), $\frac{5}{16}$ x $1\frac{1}{2}$ in. square	2
PE 2042	Jam Nut for Board Brace, $\frac{5}{8}$ in. Hexagon, Left Hand Thread	2
P 4227	Plow Bolt, Landside to Head, Brace to Mouldboard, also Mouldboard to Head, No. 7, $\frac{7}{16}$ x $1\frac{1}{4}$ in.	4
P 4228	Plow Bolts, Steel Share to Head, No. 7, $\frac{7}{16}$ x $1\frac{1}{4}$ in., Left Hand Thread	4
P 5630	Plow Bolt, Landside and Head to Beam, No. 7, $\frac{5}{8}$ x $2\frac{1}{2}$ in.	2
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, No. 7 Head, $\frac{5}{8}$ in. dia. x $3\frac{3}{4}$ in.	2
P 10868	Cast Thimble for Shock Shoe for (Cast Shares)	1
P 12203	Share, less Bolts (8 in., solid steel)	2
P 12203 $\frac{1}{2}$	Share (8 in., solid steel), with Bolts	2
P 12205	Share, less Bolts (10 in., solid steel)	2
P 12205 $\frac{1}{2}$	Share (10 in., solid steel), with Bolts	2
P 12206	Share (8 in., cast)	2
P 13102	Share, less Bolts (9 in., solid steel)	2
P 13102 $\frac{1}{2}$	Share (9 in., solid steel), with Bolts	2
P 13903	Wing Share (8 in., cast)	2
P 13911	Share (9 in., cast)	2
P 14390	Mouldboard, less Bolts (soft centre)	2
P 14390 $\frac{1}{2}$	Mouldboard (soft centre), with Bolts	2
P 14393	Head for Mouldboard and Share	2
P 14394	Landside, less Bolts (front), $4\frac{3}{4}$ x $\frac{3}{8}$ x 12 in.	2
P 14394 $\frac{1}{2}$	Landside (front), with Bolts	1
P 14395	Landside, less Bolts (rear), $4\frac{3}{4}$ x $\frac{3}{8}$ x $14\frac{3}{4}$ in.	2
P 14395 $\frac{1}{2}$	Landside (rear), with Bolts	1
P 14396	Brace for Mouldboard (right), $\frac{5}{8}$ in. dia., 6 in. Left Hand Thread	2
P 14397	Brace for Mouldboard (left), $\frac{5}{8}$ in. dia. x 6 in.	2
P 14832A	Bracket for Mouldboard Braces, $1\frac{3}{4}$ x $\frac{1}{2}$ x $4\frac{3}{4}$ in.	2
P 14982	Shock Shoe for (Cast Shares), $1\frac{1}{2}$ x $\frac{3}{8}$ x $7\frac{3}{4}$ in.	1
P 15279	Turnbuckle, for Mouldboard Brace, $\frac{5}{8}$ in., R.H. and L.H. Thread	2

MASSEY-HARRIS No. 27 GANG PLOW

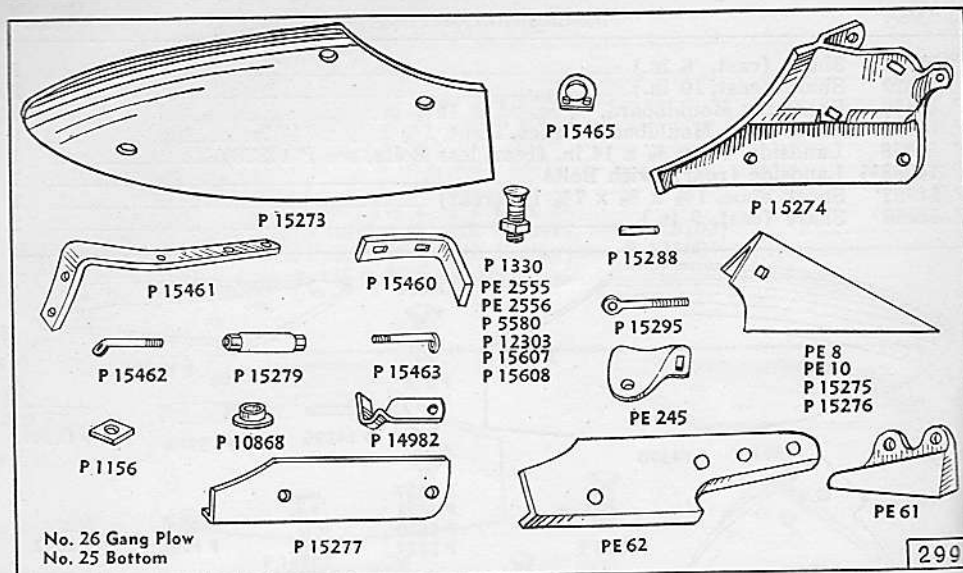


No. 25 BOTTOM

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 8	Share (cast, needle point, 8 in.)	
PE 10	Share (cast, 10 in.)	
PE 61	Heel for Rear Landside (cast)	
PE 62	Landside (rear, cast, see P 15277)	
PE 62½	Landside and Heel (rear), complete, 1 PE 61, 1 PE 62	
P 1156	Washer on Beams (lower), 5/16 x 1½ in. square (steel)	
P 1330	Plow Bolt, Landside to Head, also Heel to Landside, ½ in. dia. x 1¾ in., No. 3 Head	
PE 2555	Plow Bolt, rear end of Mouldboard, ½ in. dia. x 1¾ in., No. 3½ Head	
PE 2556	Plow Bolt, Landside, Head and Shock Shoe to Beam, ⅝ in. dia. x 3¼ in., No. 3 Head	
P 5580	Plow Bolt, Head to Beam, ⅝ in. dia. x 2¼ in., No. 3 Head	
P 6383	Washer for Channel Beam (cast)	
P 10868	Thimble for Shock Shoe (cast)	
P 12303	Plow Bolt, Brace to Landside, ½ in. dia. x 2½ in., No. 3 Head	
P 14982	Shock Shoe, 1½ x ¾ x 7¾ in. (rear)	
P 15273	Mouldboard (soft centre, steel), less Bolts	
P 15273½	Mouldboard, with Bolts	
P 15274	Head for Mouldboard and Share, less Bolts	
P 15275	Share (cast, 8 in.)	
P 15276	Share (cast, 9 in.)	
P 15277	Landside (front, cast, see PE 62)	
P 15279	Turnbuckle, for Mouldboard Brace, ⅝ in. Right and Left Hand Thread (cast)	
P 15288	Wooden Pin for Share, 5/16 x 1½ in.	
P 15295	Eyebolt for Dip Adjusting Bracket, ⅝ in. dia., 5½ in. eye to end	
P 15460	Bracket for Mouldboard (lower, front), 1½ x ½ x 10½ in.	
P 15461	Bracket for Mouldboard (lower, rear), 1½ x ½ x 22 in.	
P 15462	Brace for Mouldboard (upper, front), ⅝ in. dia. x 9¾ in.	
P 15463	Brace for Mouldboard (upper, rear), ⅝ in. dia. x 9½ in.	
P 15465	Spacer under Mouldboard (cast)	
P 15607	Plow Bolt for Mouldboard to Brace, No. 3½, ½ in. dia. x 1½ in.	
P 15608	Plow Bolt for Mouldboard to Brace and Head, No. 3½, ½ in. dia. x 1¾ in.	

Use Only Genuine Massey-Harris Repair Parts


MASSEY-HARRIS No. 27 GANG PLOW

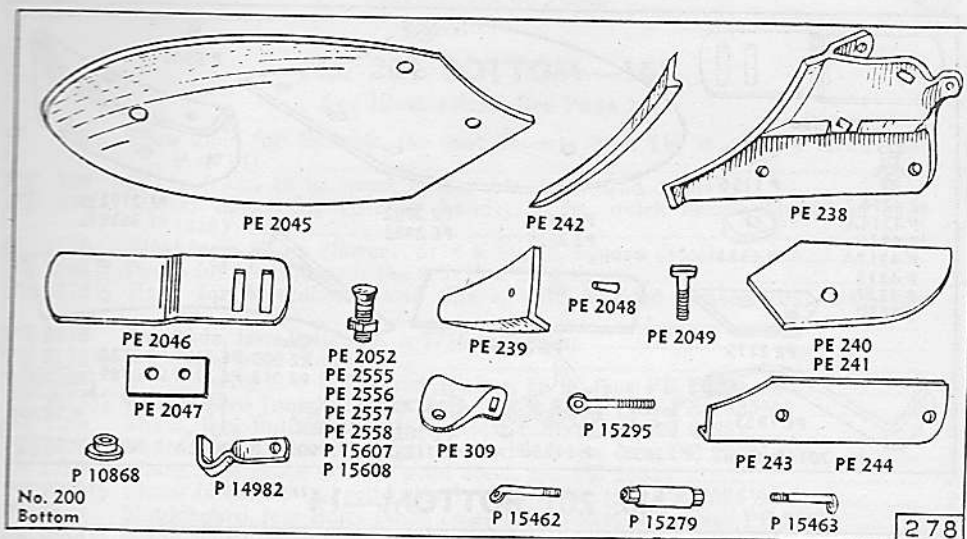

No. 200 BOTTOM

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 238	Head for Mouldboard and Share	2
PE 239	Point for Share (cast)	2
PE 240	Wing for Share (9 in., cast)	2
PE 241	Wing for Share (11 in., cast)	2
PE 242	Comb for Mouldboard (Chilled Cast)	2
PE 243	Landside (cast)	2
PE 309	Dip Adjusting Bracket	2
PE 2045	Mouldboard (drilled for Kicker), less Bolts	2
PE 2045 1/2	Mouldboard (for Kicker), with Bolts	2
PE 2046	Kicker for Mouldboard, 4 1/4 x 5/8 x 15 in.	2
PE 2047	Shim between Mouldboard and Kicker, 2 1/2 x 3/16 x 5 in. (1939-1944)	2
PE 2048	Taper Pin for Share Point, 5/8 in. dia. x 1 1/2 in.	2
PE 2049	"T" Head Bolt for Share Point, 5/8 in. dia. x 3 1/4 in.	2
PE 2052	Plow Bolt for Wing Share, 1/2 in. dia. x 1 1/2 in., No. 3 1/2 left hand thread with Hexagon Nut	2
PE 2555	Plow Bolt, Kicker to Mouldboard, 1/2 in. dia. x 1 1/4 in., No. 3 1/2 Head	2
PE 2556	Plow Bolt, Head and Shock Shoe to Beam, 5/8 in. dia. x 3 1/4 in., No. 3 Head	1
PE 2557	Plow Bolt, Head to Beam (front), 5/8 in. dia. x 2 1/4 in., No. 3 Head	1
PE 2558	Plow Bolt, Brace and Kicker to Mouldboard, 1/2 in. dia. x 2 in., No. 3 1/2 Head (1939-1944, see P 15608)	2
P 10720	Shim Washer for Adjusting Bracket, 1 1/4 x 5/16 x 1 1/2 in. (steel, front)	1
P 10868	Thimble for Shock Shoe (cast)	1
P 14982	Shock Shoe (for Cast Shares, rear), 1 1/2 x 5/8 x 7 3/4 in.	1
P 15279	Turnbuckle for Mouldboard, 5/8 in. right and left hand thread	2
P 15295	Eyebolt for Adjusting Dip Bracket, 5/8 in. dia., 5 1/2 in. eye to end	2
P 15462	Brace for Mouldboard, next to Head, 5/8 in. dia. x 9 3/4 in.	2
P 15463	Brace for Mouldboard, next to Board, 5/8 in. dia. x 9 1/2 in. left hand thread	2
P 15607	Plow Bolt, Mouldboard to Head, 1/2 in. dia. x 1 1/2 in., No. 3 1/2 Head	4
P 15608	Plow Bolt, Landside to Head, also Kicker to Mouldboard, 1/2 in. dia. x 1 1/4 in., No. 3 1/2 Head (first used 1945, see PE 2558)	6

NOTE—The word "Welded" means the part so described is WELDED to some other part or parts, and should not be ordered only as needed.

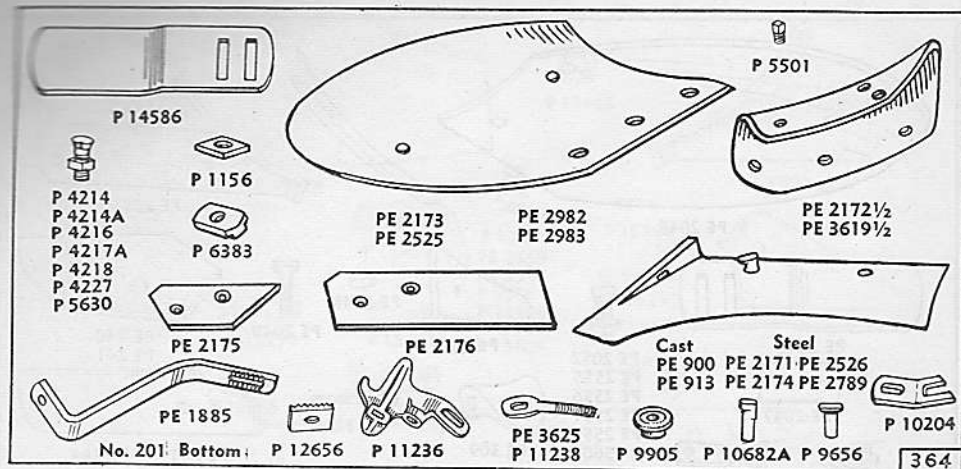

No. 201 BOTTOM—14"

List No.	DESCRIPTION OF PIECE	Quantity Used
P 1156	Washer on Beams (lower), ½ x 1½ in. square (steel)	2
PE 1885	Brace for Mouldboard, 1½ x 5/16 x 18¼ in.	2
PE 2171	Share, less Bolts (14 in., solid steel, see PE 2174)	2
PE 2171½	Share, 14 in. solid steel, with Bolts (see PE 2174½)	2
PE 2172½	Head for Mouldboard and Share with Welded Brace (1942-1944, use PE 3619½)	2
PE 2173	Mouldboard, less Bolts (not Kicker, see PE 2982)	2
PE 2173½	Mouldboard (not Kicker), with Bolts (see PE 2982½)	2
PE 2174	Share, less Bolts (14 in., steel, soft centre, see PE 2171)	2
PE 2174½	Share, 14 in. (steel, soft centre), with Bolts (see PE 2171½)	2
PE 2175	Landside, less Bolts (front), 3¼ x 7/16 x 9¼ in.	1
PE 2175½	Landside (front), with Bolts	1
PE 2176	Landside, less Bolts (rear), 3¼ x 7/16 x 13½ in.	1
PE 2176½	Landside (rear), with Bolts	1
PE 2982	Mouldboard, less Bolts (with holes for Kicker, see PE 2173)	2
PE 2982½	Mouldboard (with holes for Kicker), with Bolts	2
PE 3619½	Head for Mouldboard and Share (with Welded Brace, first used 1945, will repair PE 2172½)	2
PE 3625	Draw Spoon for Share, ⅝ in. dia. thread and 6¼ in. overall x 1¼ in. slot (first used 1945, see P 11238)	2
P 4214	Plow Bolt for Kicker to Mouldboard, ⅝ x 1 in., No. 7 Head	4
P 4214A	Plow Bolt for Mouldboard, Head and Brace, ⅝ x 1½ in., No. 7	6
P 4216	Plow Bolt for Thimble (to Steel Share), ⅝ x 1¼ in., No. 7 (see P 775)	2
P 4217A	Plow Bolt for Mouldboard to Head and Bracket, ⅝ x 1½ in., No. 7	2
P 4218	Plow Bolt for Mouldboard to Head and Share Bracket, ⅝ x 1½ in., No. 7	2
P 4227	Plow Bolt for Landside to Head, 7/16 x 1¼ in., No. 7	2
P 5501	Set Screw in Head, 7/16 x ⅝ in., Special Head	4
P 5630	Plow Bolt for Landside to Head, ⅝ x 2½ in., No. 7	2
P 6383	Washer in Channel of Beam (cast)	2
P 9656	"T" Head Rivet in Share, ⅝ x 1 in. under head	2
P 9905	Thimble for Share (cast)	2
P 10682A	Rivet in Share for Draw Bolt, 1½ in. overall	2
P 11236	Bracket for Share (cast)	2
P 11238	Draw Spoon for Share, ⅝ in. dia. thread x 6¼ in. overall x ⅝ in. slot (1942-1944, use PE 3625)	2
P 12656	Washer for Front Brace to Mouldboard, 3/16 x 1½ in. square, corrugated steel	2
P 14586	Kicker for Mouldboard, 3¼ x ¼ x 15¼ in.	2

Use Only Genuine Massey-Harris Repair Parts

MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
----------	----------------------	---------------


No. 201 BOTTOM—16"

For Illustrations, See Page 16

P 775	Plow Bolt for Thimble (to cast share), $\frac{3}{8}$ x $1\frac{1}{4}$ in., No. 4 Head (see P 4216)	4
PE 900	Share (cast, 16 in. quick detachable, first used 1945)	2
PE 913	(Cast) Share for (Stoney Land), 16 in., quick detachable (first used 1946)	2
P 1156	Washer on Beam (lower), $5/16$ x $1\frac{1}{2}$ in. square (steel)	2
PE 1885	Brace for Mouldboard, $1\frac{1}{2}$ x $5/16$ x $18\frac{1}{4}$ in.	2
PE 2172½	Head for Mouldboard and Share, with Welded Brace (1942-1944, use PE 3619½)	2
PE 2176	Landside, less Bolts, $3\frac{3}{4}$ x $7/16$ x $26\frac{3}{4}$ in.	2
PE 2176½	Landside, with Bolts	2
PE 2525	Mouldboard, less Bolts (not Kicker, 16 in., see PE 2983)	2
PE 2525½	Mouldboard (not Kicker), 16 in., with Bolts (see PE 2983½)	2
PE 2526	Share, less Bolts (steel, 16 in., soft centre, see PE 2789)	2
PE 2526½	Share (steel, 16 in., soft centre), with Bolts (see PE 2789½)	2
PE 2789	Share, less Bolts (16 in., solid steel, see PE 2526)	2
PE 2789½	Share (steel, 16 in., solid steel), with Bolts (see PE 2526½)	2
PE 2983	Mouldboard, less Bolts (with holes for Kicker, 16 in., see PE 2525)	2
PE 2983½	Mouldboard (with holes for Kicker), with Bolts (see PE 2525½)	2
PE 3619½	Head for Mouldboard and Share (with Welded Brace, first used 1945, will repair PE 2172½)	2
PE 3625	Draw Spoon for Share, $\frac{5}{8}$ in. dia. thread x $6\frac{1}{4}$ in. overall x $1\frac{1}{4}$ in. slot, first used 1945, will repair P 11238	2
P 4214	Plow Bolt for Kicker to Mouldboard, $\frac{3}{8}$ x 1 in., No. 7 Head	4
P 4214A	Plow Bolt for Mouldboard to Head, also Strap and Brace to Mouldboard, $\frac{3}{8}$ x $1\frac{1}{2}$ in., No. 7	8
P 4216	Plow Bolt (for steel share) to Thimble and Mouldboard to Brace, $\frac{3}{8}$ x $1\frac{1}{4}$ in., No. 7 (see P 775)	4
P 4218	Plow Bolt for Mouldboard to Bracket, $\frac{3}{8}$ x $1\frac{1}{2}$ in., No. 7	4
P 4227	Plow Bolt for Landside to Head, $7/16$ x $1\frac{1}{4}$ in., No. 7	2
P 5501	Set Screw in Head, $7/16$ x $\frac{5}{8}$ in. Special Head	4
P 5630	Plow Bolt for Landside to Head, $\frac{5}{8}$ x $2\frac{1}{2}$ in., No. 7	2
P 6383	Washer for Channel of Beam (cast)	2
P 9656	"T" Head Rivet in Share, $\frac{3}{8}$ x 1 in. under head	2
P 9905	Thimble for Share (cast)	4
P 10204	Strap for Share, $1\frac{1}{2}$ x $\frac{3}{8}$ x $3\frac{1}{2}$ in.	2
P 10682A	Rivet in Share for Draw Bolt, $1\frac{1}{2}$ in. overall	2
P 11236	Bracket for Share (cast)	2
P 11238	Draw Spoon for Share, $\frac{5}{8}$ in. dia. x $6\frac{1}{2}$ in. (1940-1944, use PE 3625)	2
P 12656	Washer for Front Brace to Mouldboard, $3/16$ x $1\frac{1}{2}$ in. square, corrugated steel	2
P 14586	Kicker for Mouldboard, $3\frac{1}{2}$ x $\frac{1}{4}$ x $15\frac{1}{4}$ in.	2

In Ordering Repair Parts, Always State the Accessory or Unit—
Also Machine Used On—It Helps

MASSEY-HARRIS No. 27 GANG PLOW

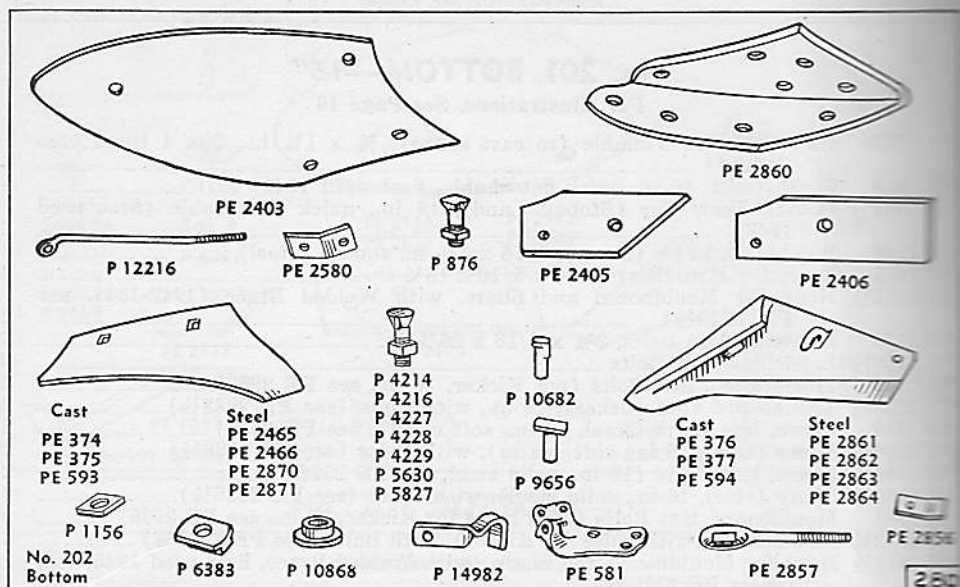

No. 202 BOTTOM

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 374	Share (cast, 10 in., bolted)	1
PE 375	Share (cast, 12 in., bolted)	1
PE 376	Share (cast, 10 in., quick, detachable)	1
PE 377	Share (cast, 12 in., quick, detachable)	1
PE 581	Bracket for Quick Detachable Shares	1
PE 593	Share (cast, 10 in. Stoney Point, bolted)	1
PE 594	Share (cast, 10 in. Stoney Point, quick, detachable)	1
P 876	Plow Bolt for (bolted cast shares) to Head, 7/16 in. dia., 1 1/4 in. left hand thread, No. 4 Head	4
P 1156	Washer in Beams (lower), 5/16 x 1 1/2 in. square (steel)	2
PE 2403	Mouldboard, less Bolts	2
PE 2403 1/2	Mouldboard, with Bolts	2
PE 2404	Head for Mouldboard and Shares (1939-1941, use PE 2860)	2
PE 2405	Landside, less Bolts (front), 4 3/4 x 3/8 x 12 in.	1
PE 2405 1/2	Landside (front), with Bolts	1
PE 2406	Landside, less Bolts (rear), 4 3/4 x 3/8 x 14 3/4 in.	1
PE 2406 1/2	Landside (rear), with Bolts	1
PE 2465	Share, less Bolts (10 in., solid steel, bolted)	2
PE 2465 1/2	Share (10 in., solid steel, bolted), with Bolts	2
PE 2466	Share, less Bolts (12 in., solid steel, bolted)	2
PE 2466 1/2	Share (12 in., solid steel, bolted), with Bolts	2
PE 2580	Bracket for Brace for Mouldboard, 1 1/2 x 5/8 x 6 in.	2
PE 2856	Strap for Quick Detachable Shares, 7/8 x 1/4 x 2 1/4 in.	2
PE 2857	Draw Bolt for Quick Detachable Shares, 5/8 in. dia. x 9 in.	2
PE 2860	Head for Mouldboard and Share (first used 1942, will repair PE 2404)	2
PE 2861	Share, less Bolts (10 in., soft centre, steel, quick, detachable)	2
PE 2861 1/2	Share (10 in., soft centre, steel, quick, detachable), with Bolts	2
PE 2862	Share, less Bolts (12 in., soft centre, steel, quick, detachable)	2
PE 2862 1/2	Share (12 in., soft centre, steel, quick, detachable), with Bolts	2
PE 2863	Share, less Bolts (10 in., solid steel, quick, detachable)	2


Use Only Genuine Massey-Harris Repair Parts

MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 2863½	Share (10 in., solid steel, quick, detachable), with Bolts	2
PE 2864	Share, less Bolts (12 in., solid steel, quick, detachable)	2
PE 2864½	Share (12 in., solid steel, quick, detachable), with Bolts	2
PE 2870	Share, less Bolts (10 in., soft centre, steel, bolted)	2
PE 2870½	Share (10 in., soft centre, steel, bolted), with Bolts	2
PE 2871	Share, less Bolts (12 in., soft centre, steel, bolted)	2
PE 2871½	Share (12 in., soft centre, steel, bolted), with Bolts	2
P 4214	Plow Bolt, Strap to Quick Detachable Share, ¾ in. dia. x 1 in., No. 7 Head	2
P 4216	Plow Bolt, Mouldboard to Head, also Brace to Mouldboard, ¾ in. dia. x 1½ in., No. 7 (1939-1940, see P 4227)	8
P 4227	Plow Bolt, Mouldboard to Head, Brace to Mouldboard and Landside to Head, 7/16 in. dia. x 1½ in., No. 7 Head (first used 1941, see P 4216)	10
P 4228	Plow Bolt, Steel Share to Head, 7/16 in. dia. x 1½ in. left hand thread No. 7	4
P 4229	Plow Bolt, Share Bracket to Head, 7/16 in. dia. x 1½ in., No. 7	4
P 5630	Plow Bolt, Landside and Head to Beam, ½ in. dia. x 2½ in., No. 7	2
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, ½ in. dia. x 3¾ in., No. 7	1
P 6383	Washer for Channel Beam (1939-1940, cast)	2
P 9656	"Tee" Head Pin in Steel Share, ¾ x 1 in. (quick, detachable)	2
P 10682	Rivet in Steel Share for Draw Bolt, ½ x 1½ in. (quick, detachable)	2
P 10868	Thimble for Shock Shoe for Cast Shares (cast)	1
P 12216	Brace for Mouldboard, ¾ in. dia. x 13½ in.	2
P 14982	Shock Shoe for Cast Shares, 1½ x ¾ x 7¾ in.	1

NOTE—The word "Welded" means the part so described is WELDED to some other part or parts, and should not be ordered only as needed.

Nos. 204 A-B-C BOTTOMS

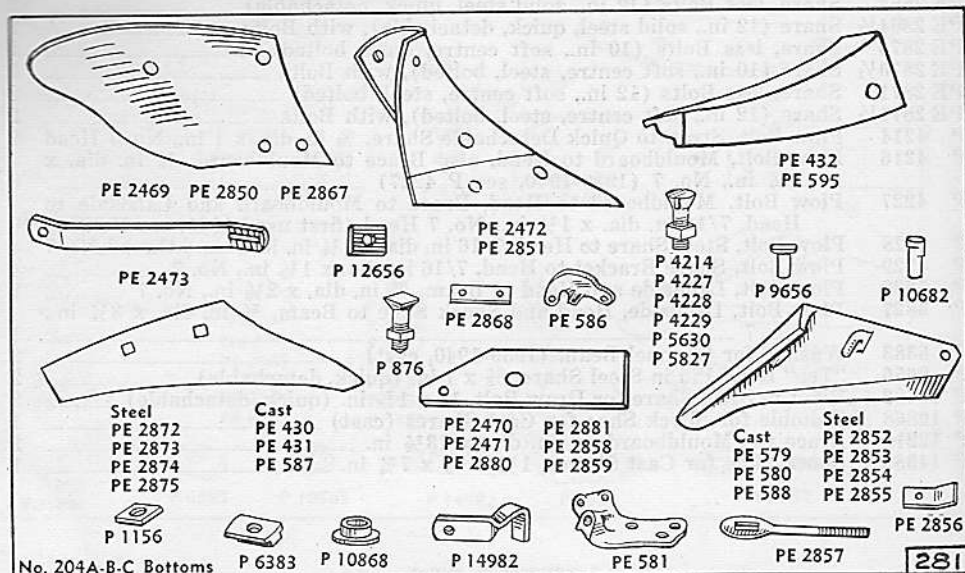

No. 204 BOTTOM 14" Bolted Shares and Cast Shin Mouldboard

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 430	Share (cast, 12 in., 1940 only, use PE 587)	2
PE 431	Share (cast, 14 in.)	2
PE 432	Shin or Comb for Mouldboard (1940 only, cast, use PE 2880½)	2
PE 586	Bracket for Cutaway Shin (to convert to Cutaway Shin in Field)	2
PE 587	Share (cast, 12 in., Stoney Point, first used 1941, will repair PE 430)	2
PE 595	Shin or Comb for Mouldboard (Cutaway, cast, first used 1941, see PE 432)	2
P 876	Plow Bolt for (Cast) Shares to Head, 7/16 in. dia. x 1¼ in., left hand thread, No. 4 Head (see P 4228)	4
P 1156	Washer on Beams (lower), 5/16 x 1½ in. square (steel)	2
PE 2469	Mouldboard (1940 only, use PE 2867½)	2
PE 2470	Landside, plain (front), 4¾ x ¾ x 13 in. (1940 only, see PE 2880)	1
PE 2470½	Landside (front), with Bolts (1940 only, see PE 2880¼)	1
PE 2471	Landside, plain (rear), 4¾ x ¾ x 15 in. (1940 only, see PE 2881)	1
PE 2471½	Landside (rear), with Bolts (1940 only, see PE 2881¼)	1
PE 2472	Head for Mouldboard and Share (1939-1941, use PE 2851)	2
PE 2473	Brace for Mouldboard, 1½ x 5/16 x 18 in.	2
PE 2851	Head for Mouldboard and Share (first used 1942, will repair PE 2472)	2
PE 2867	Mouldboard, less Bolts (first used 1941, will repair PE 2469)	2
PE 2867½	Mouldboard, with Bolts (first used 1941, will repair PE 2469)	2
PE 2868	Strap for Shin on Mouldboard, 1 x ¼ x 3¼ in. (first used 1941)	2
PE 2872	Share, less Bolts (steel, 12 in., soft centre)	2
PE 2872½	Share (steel, 12 in., soft centre), with Bolts	2
PE 2873	Share, less Bolts (steel, 12 in., solid steel)	2
PE 2873½	Share (steel, 12 in., solid steel), with Bolts	2

In Ordering Repair Parts, Always State the Accessory or Unit—
Also Machine Used On—It Helps

MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 2874	Share, less Bolts (steel, 14 in., soft centre)	2
PE 2874½	Share (steel, 14 in., soft centre), with Bolts	2
PE 2875	Share, less Bolts (steel, 14 in., solid steel)	2
PE 2875½	Share (steel, 14 in., solid steel), with Bolts	2
PE 2880	Landside, less Bolts (front), 4½ x ¾ x 13 in. (first used 1941, see PE 2470)	1
PE 2880¼	Landside (front), with Bolts (first used 1941, see PE 2470½)	1
PE 2880½	Landside (front), complete, 1 PE 586, 1 PE 595, 1 PE 2880, first used 1941 for converting to Cutaway Shin in Field (also will repair PE 432)	1
PE 2881	Landside, less Bolts (rear), 4½ x ¾ x 15 in., first used 1941 (see PE 2471)	1
PE 2881¼	Landside (rear), with Bolts (first used 1941, see PE 2471½)	1
PE 2881½	Landside (rear), complete, 1 PE 586, 1 PE 595, 1 PE 2881, first used 1941, for converting to Cutaway in Field (also will repair PE 432)	1
P 4227	Plow Bolt, Landside, Comb, and Mouldboard to Head, also Brace to Mouldboard, 7/16 in. dia. x 1¼ in., No. 7 Head	12
P 4228	Plow Bolt for (Steel) Shares to Head, 7/16 x 1¼ in., No. 7 Head (see P 876)	2
P 5630	Plow Bolt, Landside and Head to Beam, ¾ in. dia. x 2½ in., No. 7 Head	2
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, ¾ in. dia. x 3¼ in., No. 7	2
P 6383	Washer for Channel Beam (cast)	2
P 10868	Thimble for Shock Shoe for Cast Shares (cast)	1
P 12656	Washer for Brace to Mouldboard, 3/16 x 1½ in. square, corrugated steel	2
P 14982	Shock Shoe for Cast Shares, 1½ x ¾ x 7¾ in.	1

No. 204 "A" BOTTOM — 14" Bolted Shares and Non Shin Mouldboard

For Illustrations, See Page 20

PE 430	Share (cast, 12 in., 1941 only, use PE 587)	2
PE 431	Share (cast, 14 in.)	2
PE 587	Share (cast, 12 in., Stoney Point)	2
P 876	Plow Bolt for (Cast) Shares to Head, 7/16 in. dia. x 1¼ in. left hand thread (see P 4228)	4
P 1156	Washer on Beams (lower), 5/16 x 1½ in. square (steel)	2
PE 2472	Head for Mouldboard and Share (1941 only, use PE 2851)	2
PE 2473	Brace for Mouldboard, 1½ x 5/16 x 18 in.	2
PE 2850	Mouldboard, less Bolts	2
PE 2850½	Mouldboard, with Bolts	2
PE 2851	Head for Mouldboard and Share (first used 1942, will repair PE 2472)	2
PE 2858	Landside, less Bolts (front), 4½ x ¾ x 19 in.	1
PE 2858½	Landside (front), with Bolts	1
PE 2859	Landside, less Bolts (rear), 4½ x ¾ x 14¾ in.	1
PE 2859½	Landside (rear), with Bolts	1
PE 2872	Share, less Bolts (steel, 12 in., soft centre)	2
PE 2872½	Share, with Bolts (steel, 12 in., soft centre)	2
PE 2873	Share, less Bolts (steel, 12 in., solid steel)	2
PE 2873½	Share, with Bolts (steel, 12 in., solid steel)	2
PE 2874	Share, less Bolts (steel, 14 in., soft centre)	2
PE 2874½	Share, with Bolts (steel, 14 in., soft centre)	2
PE 2875	Share, less Bolts (steel, 14 in., solid steel)	2
PE 2875½	Share, with Bolts (steel, 14 in., solid steel)	2
P 4227	Plow Bolt, Landside and Mouldboard to Head, also Brace to Mouldboard, 7/16 in. dia. x 1¼ in., No. 7	10
P 4228	Plow Bolt for (Steel) Share to Head, 7/16 in. dia. x 1¼ left hand thread, No. 7 (see P 876)	4
P 5630	Plow Bolt for Landside to Head and Beam, ¾ in. dia. x 2½ in., No. 7	2
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, ¾ in. dia. x 3¼ in., No. 7	1
P 6383	Washer for Channel Beam (cast)	2
P 10868	Thimble for Shock Shoe for Cast Share (cast)	1
P 12656	Washer for Brace to Mouldboard, 3/16 x 1½ in. square, corrugated steel	2
P 14982	Shock Shoe for Cast Share, 1½ x ¾ x 7¾ in.	1

Use Only Genuine Massey-Harris Repair Parts

MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
----------	----------------------	------------------

No. 204 "B" BOTTOM — 14" Quick Detachable Shares and Cast Shin Mouldboard

For Illustrations, See Page 20

PE 579	Share (cast, 12 in., quick detachable, 1941 only, use PE 588)	2
PE 580	Share (cast, 14 in., quick, detachable)	2
PE 581	Bracket for Share	2
PE 582	Share (cast, 12 in., quick, detachable, stoney point, will repair PE 579)	2
PE 583	Shin or Comb for Mouldboard (Cut-away) (cast)	2
P 1056	Washer on Beams (lower), 5/16 x 1 1/2 in. square (steel)	2
P 1467	Plow Bolt, Bracket to Sideless Share, 7/16 x 1 1/2 in., No. 3	2
PE 2473	Brace for Mouldboard, 1 1/2 x 5/16 x 18 in.	2
PE 2851	Head for Mouldboard and Share	2
PE 2852	Share, less Bolts (steel, 12 in., soft centre, quick detachable)	2
PE 2852 1/2	Share, with Bolts (steel, 12 in., soft centre, quick detachable)	2
PE 2853	Share, less Bolts (steel, 14 in., soft centre, quick detachable)	2
PE 2853 1/2	Share, with Bolts (steel, 14 in., soft centre, quick detachable)	2
PE 2854	Share, less Bolts (12 in. solid steel, quick detachable)	2
PE 2854 1/2	Share, with Bolts (12 in. solid steel, quick detachable)	2
PE 2855	Share, less Bolts (14 in. solid steel, quick detachable)	2
PE 2855 1/2	Share, with Bolts (14 in. solid steel, quick detachable)	2
PE 2856	Strap for Quick Detachable Share, 7/8 x 1/4 x 2 1/4 in.	2
PE 2857	Draw Bolt for Quick Detachable Share, 5/8 in. dia. x 9 in.	2
PE 2867	Mouldboard, less Bolts	2
PE 2867 1/2	Mouldboard, with Bolts	2
PE 2868	Strap for Shin on Mouldboard, 1 x 1/4 x 3 1/4 in.	2
PE 2880	Landside (front), less Bolts, 4 1/2 x 3/8 x 13 in.	1
PE 2880 1/4	Landside (front), with Bolts	1
PE 2881	Landside (rear), less Bolts, 4 1/2 x 3/8 x 15 in.	1
PE 2881 1/4	Landside (rear), with Bolts	1
P 4214	Plow Bolt for Strap to Quick Detachable Steel Share, 5/8 in. dia. x 1 in., No. 7	2
P 4227	Plow Bolt, Mouldboard and Landside to Head, also Brace to Mouldboard, 7/16 in. dia. x 1 1/4 in., No. 7	6
P 4229	Plow Bolt, Mouldboard and Shin to Head and Bracket, 7/16 in. dia. x 1 1/2 in., No. 7	6
P 5630	Plow Bolt, Landside and Head to Beam, 5/8 in. dia. x 2 1/2 in., No. 7	1
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, 5/8 in. dia. x 3 1/4 in., No. 7	1
P 6383	Washer for Channel Beam (cast)	2
P 9656	"T" Head Rivet in Steel Share, 5/8 x 1 in.	2
P 10682	Rivet in Steel Share for Draw Bolt, 1/2 x 1 1/8 in.	2
P 10868	Thimble for Shock Shoe for Cast Share (cast)	1
P 12656	Washer for Brace to Mouldboard, 3/16 x 1 1/2 in. square, corrugated steel	2
P 14982	Shock Shoe (for cast share), 1 1/2 x 3/8 x 7 3/4 in.	1

NOTE—The word "Welded" means the part so described is WELDED to some other part or parts, and should not be ordered only as needed.

MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
----------	----------------------	------------------


No. 204 "C" BOTTOM — 14" Quick Detachable Shares and Non Shin Mouldboard

For Illustrations, See Page 20

PE 579	Share (cast, 12 in., quick, detachable, 1941 only (use PE 588)	2
PE 580	Share (cast, 14 in., quick, detachable)	2
PE 581	Bracket for Share	2
PE 588	Share (cast, 12 in., quick, detachable, stoney point, first used 1941, will repair PE 579)	2
P 1156	Washer on Beams (lower), 5/16 x 1 1/2 in. square (steel)	2
PE 2473	Brace for Mouldboard, 1 1/2 x 5/16 x 18 in.	2
PE 2850	Mouldboard, less Bolts	2
PE 2850 1/2	Mouldboard, with Bolts	2
PE 2851	Head for Mouldboard and Share	2
PE 2852	Share, less Bolts (steel, 12 in., soft centre, quick detachable)	2
PE 2852 1/2	Share, with Bolts (steel, 12 in., soft centre, quick detachable)	2
PE 2853	Share, less Bolts (steel, 14 in., soft centre, quick detachable)	2
PE 2853 1/2	Share, with Bolts (steel, 14 in., soft centre, quick detachable)	2
PE 2854	Share, less Bolts (steel, 12 in., solid steel, quick detachable)	2
PE 2854 1/2	Share, with Bolts (steel, 12 in., solid steel, quick detachable)	2
PE 2855	Share, less Bolts (steel, 14 in., solid steel, quick detachable)	2
PE 2855 1/2	Share, with Bolts (steel, 14 in., solid steel, quick detachable)	2
PE 2856	Strap for Quick Detachable Share, 7/8 x 1/4 x 2 1/4 in.	2
PE 2857	Draw Bolt for Quick Detachable Share, 5/8 in. dia. x 9 in.	2
PE 2858	Landside, less Bolts (front), 4 1/2 x 5/8 x 19 in.	1
PE 2858 1/2	Landside (front), with Bolts	1
PE 2859	Landside (rear), less Bolts, 4 1/2 x 5/8 x 14 3/4 in.	1
PE 2859 1/2	Landside (rear), with Bolts	1
P 4214	Plow Bolt for Strap to Quick Detachable Steel Share, 5/8 in. dia. x 1 in., No. 7	2
P 4227	Plow Bolt, Mouldboard and Landside to Head, also Brace to Mouldboard, 7/16 in. dia. x 1 1/4 in., No. 7	6
P 4229	Plow Bolt, Mouldboard and Shin to Head and Bracket, 7/16 in. dia. x 1 1/2 in., No. 7	6
P 5630	Plow Bolt, Landside and Head to Beam, 5/8 in. dia. x 2 1/2 in., No. 7	1
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, 5/8 in. dia. x 3 1/4 in., No. 7	1
P 6383	Washer for Channel Beam (cast)	2
P 9656	"T" Head Rivet in Steel Share, 5/8 x 1 in.	2
P 10682	Rivet in Steel Share for Draw Bolt, 1/2 x 1 1/8 in.	2
P 10868	Thimble for Shock Shoe for Cast Share (cast)	1
P 12656	Washer for Brace to Mouldboard, 3/16 x 1 1/2 in. square, corrugated steel	2
P 14982	Shock Shoe (for cast share), 1 1/2 x 5/8 x 7 3/4 in.	1

In Ordering Repair Parts, Always State the Accessory or Unit—
Also Machine Used On—It Helps

MASSEY-HARRIS No. 27 GANG PLOW

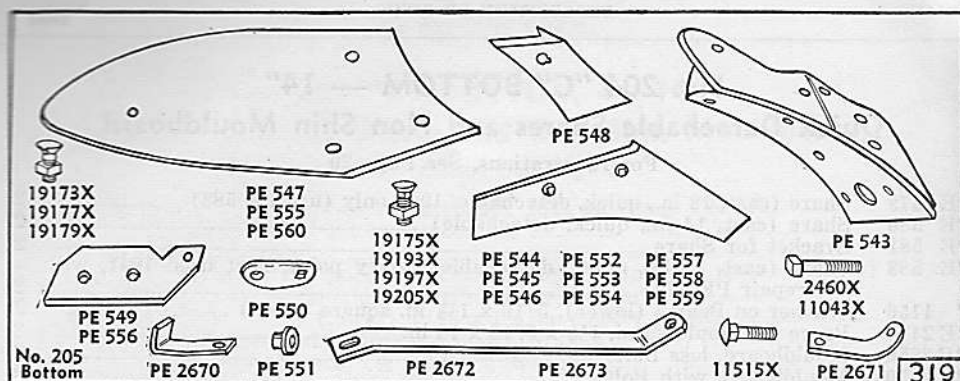

No. 205 BOTTOM—12", 14" and 16" (Cast Mouldboard, Landsides and Share)

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 543	Frog or Head for Mouldboard (Supplier's No. MH 23)	2
PE 544	Share (cast, 12 in.)	2
PE 545	Share (stony point, 12 in., cast)	2
PE 546	Share (deep suck, 12 in., cast)	2
PE 547	Mouldboard (12 in., cast)	2
PE 548	Shin for Mouldboard (cast)	2
PE 549	Landside (12 in., cast)	2
PE 550	Brace (short, cast, Suppliers No. 546 J)	2
PE 551	Thimble for Dropper or Shock Shoe	1
PE 552	Share (cast, 14 in.)	2
PE 553	Share (stony point, 14 in., cast)	2
PE 554	Share (deep suck, 14 in., cast)	2
PE 555	Mouldboard (14 in., cast)	2
PE 556	Landside (14 in. and 16 in., cast)	2
PE 557	Share (cast, 16 in.)	2
PE 558	Share (stony point, 16 in., cast)	2
PE 559	Share (deep suck, 16 in., cast)	2
PE 560	Mouldboard (16 in., cast)	2
2460X	Bolt, Frog to Beam, $\frac{5}{8}$ x 3 in. Machine Head	2
PE 2670	Dropper or Shock Shoe	1
PE 2671	Brace, short (steel)	2
PE 2672	Brace, Frog to Mouldboard (long), 12 in.	2
PE 2673	Brace, Frog to Mouldboard (long), 14 in. and 16 in.	2
2758X	Nut for Bolt, Landside to Frog and Beam, also for Bolt Frog to Beam, $\frac{5}{8}$ in. square	4
2765X	Lock Washer for Nut for Bolt, Frog to Beam, $\frac{5}{8}$ in.	4
11043X	Bolt for Frog to Beam, $\frac{5}{8}$ x $3\frac{1}{2}$ in. Machine Head	2
11063X	Nut for Bolt, Mouldboard to Frog, Brace to Frog, Cast Brace to Mouldboard, Bolt for Shares, Shin to Frog, Landside to Frog, $\frac{7}{16}$ in. square	4
11515X	Bolt, Brace to Beam, $\frac{7}{16}$ x $1\frac{1}{4}$ in. Carriage Head	2
12508X	Steel Washer on 3 in. Bolt for Frog to Beam, $\frac{5}{8}$ in.	2
13093X	Steel Washer on Bolt, Brace to Mouldboard, also on Bolt, Shin to Frog, $\frac{7}{16}$ in.	2
19173X	Bolt, Left Hand Thread, for Shares, $\frac{7}{16}$ x $1\frac{1}{2}$ in., No. 1 Plow Head	2
19175X	Bolt, Left Hand Thread, for Shares, $\frac{7}{16}$ x $1\frac{1}{4}$ in., No. 3 Plow Head	2
19177X	Bolt, Cast Brace to Mouldboard, $\frac{7}{16}$ x $1\frac{1}{4}$ in., No. 1 Plow Head	2
19179X	Bolt, Mouldboard to Frog, Brace to Mouldboard, also Shin to Frog, $\frac{7}{16}$ x $1\frac{1}{2}$ in., No. 1 Plow Head	2
19193X	Bolt, Landside to Frog, $\frac{7}{16}$ x $1\frac{1}{2}$ in., No. 3 Plow Head	2
19197X	Bolt, Brace to Frog, Steel Brace to Frog, also Landside to Frog and Brace, $\frac{7}{16}$ x $2\frac{1}{4}$ in., No. 3 Plow Head	2
19205X	Bolt, Landside to Frog and Beam, $\frac{5}{8}$ x $2\frac{1}{4}$ in., No. 3 Plow Head	2



Use Only Genuine Massey-Harris Repair Parts

MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 1601	Landside (rear), less Bolts, 3 x 7/16 x 17 in. (sideless, see PE 1065)	1
PE 1601½	Landside (rear), with Bolts (sideless, see PE 1065½)	1
PE 1602	Share, less Bolts (steel, 12 in., sideless, see P 12644, P 12645, P 12645HM)	2
PE 1602½	Share (steel, 12 in.), with Bolts (sideless, see P 12645½, P 12645HM½)	2
PE 1603	Strap for (sideless, steel share), 1¼ x ¾ x 4 in.	2
PE 1676	Shim (large for sideless steel share), 1¼ x 1/16 x 5¾ in.	2
PE 1677	Shim (small for sideless steel share), 1¼ x 1/16 x 1½ in.	2
P 4214	Plow Bolt, for Kicker to Mouldboard, ¾ x 1 in., No. 7	2
P 4214A	Plow Bolt, Brace to Mouldboard and Mouldboard to Head (not sideless), ¾ in. dia. x 1½ in., No. 7	4
P 4216	Plow Bolt, P 9905 Thimble to Steel Share, ¾ in. dia. x 1¼ in., No. 7	6
P 4217A	Plow Bolt, Share Bracket to Mouldboard, ¾ in. dia. x 1¾ in., No. 7	6
P 4218	Plow Bolt, Share Bracket to Head, ¾ in. dia. x 1¾ in., No. 7	2
P 4227	Plow Bolt, Landside to Head, 7/16 in. dia. x 1½ in., No. 7	2
P 5501	Set Screw in Head, 7/16 in. dia. x ¾ in. special head	4
P 5630	Plow Bolt, Landside and Head to Beam, ¾ in. dia. x 2½ in., No. 7	4
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, ¾ in. dia. x 3¼ in., No. 7	2
P 6383	Washer for Channel Beam (cast)	1
P 9656	"T" Head Rivet in Steel Share (not sideless), ¾ x 1 in.	2
P 9905	Thimble for Share (not sideless), ¾ in. O.D. x 5/16 in., ¾ in. bore (cast)	2
P 10682A	Rivet in Steel Share for Draw Bolt (not sideless), ½ x 1¾ in.	2
P 10868	Thimble for Shock Shoe for Cast Share (cast)	2
P 11235	Bracket for Share (not sideless, cast)	1
P 11237	Draw Spoon for Share (not sideless, cast)	2
P 12640	Head for Mouldboard and Share (not sideless), ¾ x 6 in.	2
P 12640A	Head for Mouldboard and Sideless Share	2
P 12642	Mouldboard, less Bolts (not Kicker, see P 14591)	2
P 12642½	Mouldboard, with Bolts (not Kicker, see P 14591½)	2
P 12644	Share, less Bolts (steel, 12 in., soft centre, quick detachable, not sideless, see PE 1602)	2
P 12644½	Share (steel, 12 in., soft centre), with Bolts (quick detachable, not sideless, see P 1602½)	2
P 12645	Share, less Bolts (steel, 12 in. solid steel, quick detachable, not sideless, see PE 1602)	2
P 12645½	Share (steel, 12 in., solid steel), with Bolts (quick detachable, not sideless, see PE 1602½)	2
P 12645HM	Share, less Bolts (high manganese steel, 12 in., quick detachable, not sideless, see PE 1602, P 12645)	2
P 12645HM½	Share (high manganese steel, 12 in.), with Bolts (quick detachable, not sideless, see PE 1602½)	2
P 12654	Brace for Mouldboard, 1½ x ¼ x 13¼ in.	2
P 12656	Washer for Brace to Mouldboard, 3/16 x 1½ in. square, corrugated steel	2
P 14586	Kicker for Mouldboard, 3½ x ¼ x 15¼ in.	2
P 14591	Mouldboard, less Bolts (for Kicker, see P 12642)	2
P 14591½	Mouldboard, with Bolts (for Kicker, see P 12642½)	2
P 14982	Shock Shoe (for cast share), 1½ x ¾ x 7¾ in.	1

14" MEDIUM BOTTOM

For Illustrations, See Page 25

P 1156	Washer on Beams (lower), 5/16 x 1½ in. square (steel)	2
P 3094	Plow Bolt for Sideless Share to Head, also Share to Strap, 7/16 in. dia. x 1¼ in., No. 3	2
PE 3625	Draw Spoon for Share, ¾ in. dia. thread x 6¼ in. overall x 1¼ in. slot (first used 1946, will repair P 11238)	3
P 4214	Plow Bolt for Kicker to Mouldboard, ¾ x 1 in., No. 7	2
P 4214A	Plow Bolt, Brace to Mouldboard, ¾ x 1¾ in., No. 7	4
P 4216	Plow Bolt, Mouldboard to Head and Thimble to Share, ¾ in. dia. x 1¼ in., No. 7	2
P 4217A	Plow Bolt, Share Bracket to Mouldboard, ¾ in. dia. x 1¾ in., No. 7	6

NOTE—The word "Welded" means the part so described is WELDED to some other part or parts, and should not be ordered only as needed.

MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
P 4218	Plow Bolt, Share Bracket to Head and Mouldboard, $\frac{3}{8}$ in. dia. x $1\frac{1}{2}$ in., No. 7	2
P 4227	Plow Bolt, Landside to Head, $7/16$ in. dia. x $1\frac{1}{4}$ in., No. 7	2
P 5501	Set Screw in Head, $7/16$ x $\frac{3}{8}$ in. special head	4
P 5630	Plow Bolt, Landside and Head to Beam, $\frac{3}{8}$ in. dia. x $2\frac{1}{2}$ in., No. 7	2
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, $\frac{3}{8}$ in. dia. x $3\frac{1}{4}$ in., No. 7	1
P 6383	Washer for Channel Beam (cast)	2
P 9656	"T" Head Rivet in Steel Share, $\frac{3}{8}$ x 1 in.	2
P 9905	Thimble for Share, $\frac{3}{8}$ in. O.D. x $5/16$ in., $\frac{3}{8}$ in. bore (cast)	2
P 10682A	Rivet in Steel Share for Draw Bolt, $\frac{1}{2}$ in. dia. x $1\frac{1}{8}$ in.	2
P 10868	Thimble for Shock Shoe for Cast Share (cast)	1
P 11236	Bracket for Share (cast)	2
P 11238	Draw Spoon for Share, $\frac{3}{8}$ in. dia. x $7\frac{1}{4}$ in.	2
P 12641	Head for Mouldboard and Share (1939-1941, use P 12641 $\frac{1}{2}$)	2
P 12641A	Head (plain), Argentine only (see P 12641 $\frac{1}{2}$)	2
P 12641 $\frac{1}{2}$	Head (with Welded Brace, not Argentine, first used 1942, will repair P 12641)	2
P 12643	Mouldboard, less Bolts (14 in., not Kicker, see P 14592)	2
P 12643 $\frac{1}{2}$	Mouldboard, with Bolts (14 in., not Kicker, see P 14592 $\frac{1}{2}$)	2
P 12647	Share, less Bolts (steel, 14 in., soft centre, quick detachable, not sideless, see P 15335)	2
P 12647 $\frac{1}{2}$	Share (steel, 14 in., soft centre), with Bolts (quick detachable, not sideless, see P 15335 $\frac{1}{2}$)	2
P 12648	Share, less Bolts (steel, 14 in., solid steel, quick detachable, not sideless, see P 15335)	2
P 12648 $\frac{1}{2}$	Share (steel, solid steel), with Bolts (quick detachable, not sideless, see P 15335 $\frac{1}{2}$)	2
P 12650	Landside (front), less Bolts, $3\frac{3}{4}$ x $7/16$ x $6\frac{3}{8}$ in., 14 in. (not sideless, see P 15363)	1
P 12650 $\frac{1}{2}$	Landside (front), with Bolts (not sideless, see P 15363 $\frac{1}{2}$)	1
P 12652	Landside (rear), less Bolts, $3\frac{3}{4}$ x $7/16$ x $12\frac{1}{2}$ in. (not sideless, see P 15364)	1
P 12652 $\frac{1}{2}$	Landside (rear), with Bolts (not sideless, see P 15364 $\frac{1}{2}$)	1
P 12655	Brace for Mouldboard, $1\frac{1}{2}$ x $5/16$ x $16\frac{1}{2}$ in.	2
P 12656	Washer for Brace to Mouldboard, $3/16$ x $1\frac{1}{2}$ in. square, corrugated steel	2
P 14586	Kicker for Mouldboard, $3\frac{1}{2}$ x $\frac{1}{4}$ x $15\frac{1}{4}$ in.	2
P 14592	Mouldboard, less Bolts (for Kicker, 14 in., see P 12643)	2
P 14592 $\frac{1}{2}$	Mouldboard, with Bolts (for Kicker, 14 in., see P 12648 $\frac{1}{2}$)	2
P 14982	Shock Shoe (for cast share), $1\frac{1}{2}$ x $\frac{3}{8}$ x $7\frac{3}{4}$ in.	1
P 15115	Share (cast, 14 in., quick, detachable)	2
P 15334	Share (steel, 12 in., solid steel, sideless, see P 12648)	2
P 15334 $\frac{1}{2}$	Share (steel, 12 in., solid steel), with Bolts (sideless, see P 12648 $\frac{1}{2}$)	2
P 15335	Share, less Bolts (solid steel, 14 in., sideless, see P 12647)	2
P 15335 $\frac{1}{2}$	Share (steel, 14 in., solid steel), with Bolts (sideless, see P 12647 $\frac{1}{2}$)	2
P 15335HM	Share, less Bolts (high manganese steel, 14 in., sideless, see P 12647)	2
P 15335HM $\frac{1}{2}$	Share (high manganese steel, 14 in.), with Bolts (sideless, see P 12647 $\frac{1}{2}$)	2
P 15344	Strap for Sideless Share, $1\frac{1}{4}$ x $\frac{3}{8}$ x $3\frac{3}{4}$ in.	2
P 15363	Landside, less Bolts (front sideless), $3\frac{3}{4}$ x $7/16$ x $11\frac{1}{2}$ in. (see P 12650)	1
P 15363 $\frac{1}{2}$	Landside (front), with Bolts (sideless, see P 12650 $\frac{1}{2}$)	1
P 15364	Landside, less Bolts (rear sideless), $3\frac{3}{4}$ x $7/16$ x 18 in. (see P 12652)	1
P 15364 $\frac{1}{2}$	Landside (rear), with Bolts (sideless, see P 12652 $\frac{1}{2}$)	1

In Ordering Repair Parts, Always State the Accessory or Unit—
Also Machine Used On—It Helps

MASSEY-HARRIS No. 27 GANG PLOW

Quantity
Used

List No.

DESCRIPTION OF PIECE


16" MEDIUM BOTTOM

For Illustrations, See Page 25

PE 131	Bracket for Sideless Share (cast)	2
P 1156	Washer on Beams (lower), 5/16 x 1 1/2 in. square (steel)	2
PE 1672	Share, less Bolts (high manganese steel, 16 in., sideless, see P 12997, P 12998)	2
PE 1672 1/2	Share (high manganese steel, 16 in.), with Bolts (sideless, see P 12297 1/2, P 12298 1/2)	2
PE 1673	Landside, less Bolts (sideless, see P 14162)	2
PE 1673 1/2	Landside, with Bolts (sideless, see P 14162 1/2)	2
PE 1686	Head for Mouldboard and Share	2
PE 1693	Shim between Mouldboard and Head (sideless), 1 1/4 x 6 1/2 in.	2
PE 2574	Mouldboard, less Bolts (for Kicker, 16 in., soft centre, see P 12996)	2
PE 2574 1/2	Mouldboard, with Bolts (for Kicker, 16 in., soft centre, see P 12996 1/2)	2
P 3094	Plow Bolt, Sideless Share and Strap to Head, 7/16 x 1 1/4 in., No. 3	8
PE 3625	Draw Spoon for Share, 5/8 in. dia. thread x 1 1/4 slot x 6 1/4 in. overall (first used 1946, will repair P 11238)	2
P 4214	Plow Bolt for Kicker to Mouldboard, 5/8 in. dia. x 1 in., No. 7	4
P 4214A	Plow Bolt, Mouldboard, Landside, Brace and Strap to Head, 5/8 x 1 1/2 in., No. 7	10
P 4216	Plow Bolt, for P 9905 Thimble to Share, 5/8 x 1 1/4 in., No. 7	4
P 4218	Plow Bolt, Mouldboard to Share Bracket, 5/8 x 1 1/2 in., No. 7	2
P 4219	Plow Bolt, Share Bracket to Head, 5/8 x 1 1/4 in., No. 7	2
P 4220	Plow Bolt, Landside to Head (sideless), 5/8 in. dia. x 2 in., No. 7	2
P 4227	Plow Bolt, Landside to Head, 7/16 x 1 1/4 in., No. 7	4
P 4232	Plow Bolt, Landside and Bracket to Head, 7/16 x 2 in., No. 7	2
P 5501	Set Screw in Head, 7/16 x 5/8 in. special head	4
P 5630	Plow Bolt, Landside and Head to Beam, 5/8 in. dia. x 2 1/2 in., No. 7	2
P 6383	Washer for Channel Beam (cast)	2
P 9656	"T" Head Rivet in Steel Share, 5/8 x 1 in.	2
P 9905	Thimble for Shares, 5/8 in. O.D. x 5/16 in., 5/8 in. bore (cast)	2
P 10204	Strap for Steel Share, 1 1/2 x 5/8 x 3 1/2 in.	2
P 10682A	Rivet in Steel Share for Draw Bolt, 1/2 x 1 7/8 in.	2
P 11238	Draw Spoon for Share, 5/8 in. dia. thread x 7/8 in. slot (1940-1945, use PE 3625)	2
P 12655	Brace for Mouldboard, 1 1/2 x 5/16 x 16 1/2 in.	2
P 12656	Washer for Brace to Mouldboard, 3/16 x 1 1/2 in. square, corrugated steel	2
P 12996	Mouldboard, less Bolts (not Kicker, 16 in., soft centre, see PE 2574)	2
P 12996 1/2	Mouldboard, with Bolts (not Kicker, 16 in., soft centre, see PE 2574)	2
P 12997	Share, less Bolts (steel, 16 in., soft centre, quick detachable, not sideless, see PE 1672)	2
P 12297 1/2	Share (steel, 16 in., soft centre), with Bolts (quick detachable, not sideless, see PE 1672 1/2)	2
P 12998	Share, less Bolts (steel, 16 in., solid steel, quick detachable, not sideless, see PE 1672)	2
P 12298 1/2	Share (steel, 16 in., solid steel), with Bolts (quick detachable, not sideless, see PE 1672 1/2)	2
P 12298HM	Share, less Bolts (high manganese steel, 16 in., quick detachable)	2
P 12298HM 1/2	Share (high manganese steel, 16 in.), with Bolts (quick detachable, see PE 1672 1/2)	2
P 12999	Bracket for Share (cast)	2
P 14162	Landside, less Bolts, 3/4 x 7/16 x 13 in. (not sideless, see PE 1673)	2
P 14162 1/2	Landside, with Bolts (not sideless, see PE 1673 1/2)	2
P 14586	Kicker for Mouldboard, 3 1/2 x 1/4 x 15 1/4 in.	2
P 15344	Strap for Sideless Share, 1 1/4 x 5/8 x 3 3/4 in.	2

Use Only Genuine Massey-Harris Repair Parts

LONG BOARD BOTTOMS — 12" - 14" - 16"

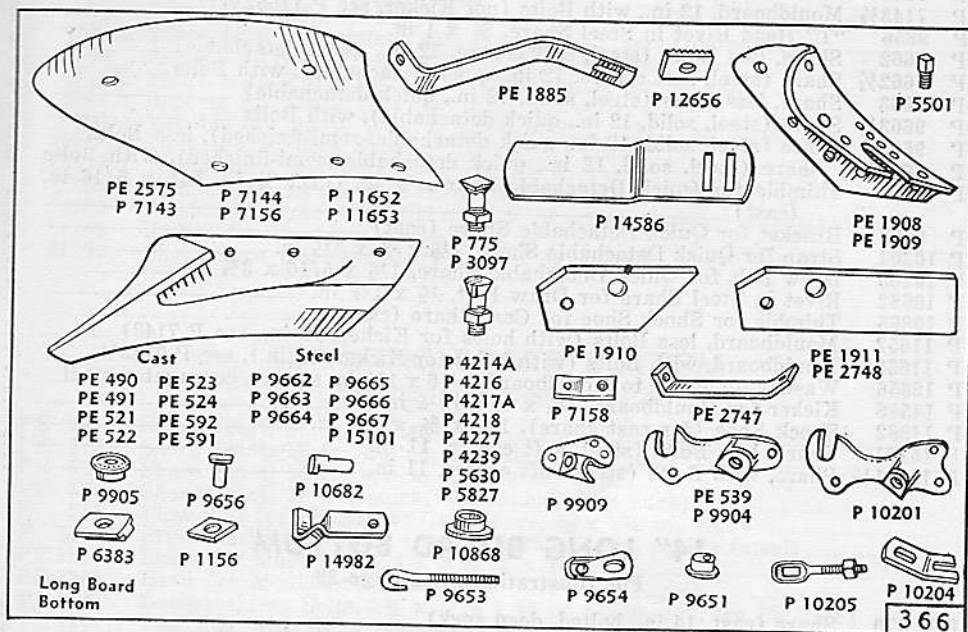

12" LONG BOARD BOTTOM

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 490	Share (cast, 12 in., bolted)	2
PE 491	Share (cast, 12 in., bolted, deep suck)	2
PE 591	Share (cast, 12 in., quick, detachable)	2
PE 592	Share (cast, 12 in., quick, detachable, stoney point)	2
P 775	Plow Bolt for Cast Share to Head (for quick, detachable, 2 used) (for bolted share, 4 used), $\frac{3}{8}$ x $1\frac{1}{4}$ in., No. 4	6
P 1156	Washer on Beams (lower), $\frac{5}{16}$ x $1\frac{1}{2}$ in. square (steel)	2
PE 1885	Brace for Mouldboard, $1\frac{1}{2}$ x $\frac{5}{16}$ x $18\frac{1}{4}$ in.	2
PE 1908	Head for Mouldboard and Share	2
PE 1910	Landside (front), less Bolts, $2\frac{3}{4}$ x $7/16$ x 8 in.	1
PE 1910 $\frac{1}{2}$	Landside (front), with Bolts	1
PE 1911	Landside (rear), less Bolts, $2\frac{3}{4}$ x $7/16$ x 13 in.	1
PE 1911 $\frac{1}{2}$	Landside (rear), with Bolts	1
P 4214A	Plow Bolt, for Mouldboard to Head, Share Strap and Brace to Mouldboard, $\frac{3}{8}$ x $1\frac{1}{2}$ in., No. 7	8
P 4216	Plow Bolt for P 9905 Thimble to Share, $\frac{3}{8}$ x $1\frac{1}{4}$ in., No. 7	1
P 4217A	Plow Bolt for Bracket to Head and Mouldboard and Bracket to Head and Share, $\frac{3}{8}$ x $1\frac{1}{2}$ in., No. 7	4
P 4227	Plow Bolt for Landside to Head, $7/16$ x $1\frac{1}{4}$ in., No. 7	2
P 4239	Plow Bolt for Thimble to Steel Share, $\frac{1}{2}$ x 2 in., No. 7	2
P 5501	Set Screw in Head, $7/16$ x $\frac{3}{8}$ in. Special Head	4
P 5630	Plow Bolt, Landside and Head to Beam, $\frac{5}{8}$ in. dia. x $2\frac{1}{2}$ in., No. 7	2
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, $\frac{5}{8}$ in. dia. x $3\frac{1}{4}$ in., No. 7	1
P 6383	Washer for Channel Beam (cast)	2

NOTE—The word "Welded" means the part so described is WELDED to some other part or parts, and should not be ordered only as needed.

MASSEY-HARRIS No. 27 GANG PLOW

List No	DESCRIPTION OF PIECE	Quantity Used
P 7143	Mouldboard, less Bolts, 12 in., not Kicker, see P 11652)	2
P 7143½	Mouldboard, 12 in., with Bolts (not Kicker, see P 11652½)	2
P 9656	"T" Head Rivet in Steel Share, ¾ x 1 in.	2
P 9662	Share, less Bolts (steel, soft centre, 12 in., quick detachable)	2
P 9662½	Share (steel, soft centre, 12 in., quick detachable), with Bolts	2
P 9663	Share, less Bolts (steel, solid, 12 in., quick detachable)	2
P 9663½	Share (steel, solid, 12 in., quick detachable), with Bolts	2
P 9663X	Share (steel, solid, 12 in., quick detachable, semi-finished), less Bolts	2
P 9663X½	Share (steel, solid, 12 in., quick detachable, semi-finished), with Bolts	2
P 9905	Thimble for Quick Detachable Share, ¾ in. O.D., ¾ in. I.D. x 5/16 in. (cast)	2
P 9909	Bracket for Quick Detachable Share (cast)	2
P 10204	Strap for Quick Detachable Share, 1½ x ¾ x 3½ in.	2
P 10205	Draw Bolt for Quick Detachable Share, 1½ x 5/16 x 3¾ in.	2
P 10682	Rivet in Steel Share for Draw Bolt, ½ x 1½ in.	2
P 10868	Thimble for Shock Shoe for Cast Share (cast)	1
P 11652	Mouldboard, less Bolts (with holes for Kicker, 12 in., see P 7143)	2
P 11652½	Mouldboard, with Bolts (with holes for Kicker, 12 in.), see P 7143½	2
P 12656	Washer for Brace to Mouldboard, 3/16 x 1½ in. square, corrugated steel	2
P 14586	Kicker for Mouldboard, 3½ x ¾ x 15¼ in.	2
P 14982	Shock Shoe (for cast share), 1½ x ¾ x 7¾ in.	1
P 15101	Share, less Bolts (steel, soft centre, 11 in.)	2
P 15101½	Share, with Bolts (steel, soft centre, 11 in.)	2

14" LONG BOARD BOTTOM

For Illustrations, See Page 29

PE 370	Share (cast, 14 in., bolted, deep suck)	2
PE 521	Share (cast, 14 in., quick, detachable)	2
PE 522	Share (cast, 14 in., quick, detachable, deep suck)	2
PE 539	Bracket for Share (first used 1941, will repair P 9904, cast)	2
P 775	Plow Bolt for Cast Share and Thimble to Cast Share, ¾ x 1¼ in., No. 4	6
P 1156	Washer on Beams (lower), 5/16 x 1½ in. square (steel)	2
PE 1885	Brace for Mouldboard, 1½ x 5/16 x 18¼ in.	2
PE 1909	Head for Mouldboard and Share	2
PE 1910	Landside (front), less Bolts, 2¾ x 7/16 x 8 in.	1
PE 1910½	Landside (front), with Bolts	1
PE 1911	Landside (rear), less Bolts, 2¾ x 7/16 x 13 in.	1
PE 1911½	Landside (rear), with Bolts	1
P 3097	Bolt in Cast, Quick, Detachable Share for Oval Washer for Share Draw Bolt, ½ x 2 in., No. 4	2
P 4214	Plow Bolt for Kicker to Mouldboard, ¾ in. dia. x 1 in., No. 7	4
P 4214A	Plow Bolt, Brace to Mouldboard, also Strap and Mouldboard to Head, ¾ x 1½ in., No. 7	8
P 4216	Plow Bolt for Thimble to Steel Share, ¾ x 1¼ in., No. 7	2
P 4217A	Plow Bolt for Bracket to Mouldboard and Mouldboard to Head, ¾ x 1½ in., No. 7	4
P 4227	Plow Bolt for Landside to Head, 7/16 x 1¼ in., No. 7	2
P 4239	Plow Bolt for Thimble to Steel Share, ½ x 2 in., No. 7	2
P 5501	Set Screw used in Head, 7/16 x ¾ in., Special Head	4
P 5630	Plow Bolt, Landside and Head to Beam, ¾ in. dia. x 2½ in., No. 7	2
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, ¾ in. dia. x 3¾ in., No. 7	1
P 6383	Washer for Channel Beam (cast)	2
P 7144	Mouldboard, less Bolts (14 in., not Kicker, see P 11653)	2
P 7144½	Mouldboard, 14 in., with Bolts (not Kicker, see P 11653½)	2
P 7158	Strap from Mouldboard to Cast Share, 1½ x ¾ x 3¾ in.	2
P 8058	Share (cast, bolted, 14 in.)	2
P 9651	Oval Washer for Share Draw Bolt, 1 x 1 x 1¼ in. (cast)	2
P 9653	Tension Hook for Share, ¾ in. dia. x 7¼ in.	2

In Ordering Repair Parts, Always State the Accessory or Unit—
Also Machine Used On—It Helps

MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
P 9654	Link for Tension Hook to Share, $1\frac{1}{2} \times 5/16 \times 3\frac{3}{8}$ in.	2
P 9656	"T" Head Rivet in Steel Share, $\frac{3}{8} \times 1$ in.	2
P 9664	Share, less Bolts (steel, soft centre, 14 in., quick detachable)	2
P 9664½	Share, with Bolts (steel, soft centre, 14 in., quick detachable)	2
P 9665	Share, less Bolts (steel, solid, 14 in., quick detachable)	2
P 9665½	Share, with Bolts (steel, solid, 14 in., quick detachable)	2
P 9904	Bracket for Share (1939-1940, use PE 539, cast)	2
P 9905	Thimble for Share, $\frac{3}{4}$ in. O.D., $\frac{3}{8}$ in. I.D. $\times 5/16$ in. (cast)	2
P 10868	Thimble for Shock Shoe for Cast Share (cast)	1
P 11653	Mouldboard, less Bolts (with hole for Kicker, 14 in., see P 7144)	2
P 11653½	Mouldboard, 14 in., with Bolts (for Kicker, see P 7144½)	2
P 12656	Washer for Brace to Mouldboard, $3/16 \times 1\frac{1}{2}$ in. square, corrugated steel	2
P 14586	Kicker for Mouldboard, $3\frac{1}{2} \times \frac{1}{4} \times 15\frac{1}{4}$ in.	2
P 14982	Shock Shoe (for cast share), $1\frac{1}{2} \times \frac{3}{8} \times 7\frac{3}{4}$ in.	1

16" LONG BOARD BOTTOM

For Illustrations, See Page 29

PE 371	Share (cast, 16 in., bolted)	2
PE 372	Share (cast, 16 in., bolted, deep suck)	2
PE 523	Share (cast, 16 in., quick, detachable)	2
PE 524	Share (cast, 16 in., quick, detachable, deep suck)	2
P 775	Plow Bolt for Thimble to Cast Share, $\frac{3}{8} \times 1\frac{1}{4}$ in., No. 4	2
P 1156	Steel Washer on Beams (lower), $5/16 \times 1\frac{1}{2}$ in. square (steel)	2
PE 1885	Brace for Mouldboard, $1\frac{1}{2} \times 5/16 \times 18\frac{1}{4}$ in.	2
PE 1909	Head for Mouldboard and Share	2
PE 1911	Landside, less Bolts, $2\frac{3}{4} \times 7/16 \times 13$ in. (1940 only, see PE 2748)	2
PE 1911½	Landside, with Bolts (1940 only, see PE 2748½)	2
PE 2575	Mouldboard, less Bolts (16 in., with holes for Kicker, see P 7156)	2
PE 2575½	Mouldboard, 16 in., with Bolts (for Kicker, see P 7156½)	2
PE 2747	Brace for Bracket to Landside, $1\frac{1}{4} \times \frac{3}{8} \times 10$ in. (first used 1941)	2
PE 2748	Landside, less Bolts, $3\frac{3}{4} \times 7/16 \times 16\frac{1}{2}$ in. (first used 1941, see PE 1911)	2
PE 2748½	Landside, with Bolts (first used 1941, see PE 1911½)	2
P 3097	Plow Bolt in Cast Share for Oval Washer for Draw Bolt, $\frac{1}{2} \times 2$ in., No. 4	2
P 4214	Plow Bolt for Kicker to Mouldboard, $\frac{3}{8}$ in. dia. $\times 1$ in., No. 7	4
P 4214A	Plow Bolt for Mouldboard to Head, also Brace and Strap to Head, $\frac{3}{8} \times 1\frac{1}{2}$ in., No. 7	6
P 4216	Plow Bolt, Thimble to Share and Bracket to Mouldboard, $\frac{3}{8} \times 1\frac{1}{4}$ in., No. 7	4
P 4218	Plow Bolt, Bracket to Mouldboard and Head, $\frac{3}{8} \times 1\frac{1}{2}$ in., No. 7	4
P 4227	Plow Bolt for Landside to Head, $7/16 \times 1\frac{1}{4}$ in., No. 7	4
P 4239	Plow Bolt for Thimble to Steel Share, $\frac{1}{2} \times 2$ in., No. 7	2
P 5501	Set Screw used in Head, $7/16 \times \frac{3}{8}$ in. Special Head	4
P 5630	Plow Bolt, Landside and Head to Beam, $\frac{5}{8}$ in. dia. $\times 2\frac{1}{2}$ in., No. 7	2
P 5827	Plow Bolt, Landside, Head and Shock Shoe to Beam, $\frac{5}{8}$ in. dia. $\times 3\frac{3}{4}$ in., No. 7	1
P 6383	Washer for Channel Beam (cast)	2
P 7156	Mouldboard, less Bolts (not Kicker, see PE 2575)	2
P 7156½	Mouldboard, with Bolts (not Kicker, see PE 2575½)	2
P 9651	Oval Washer for Share Draw Bolt, $1 \times 1 \times 1\frac{1}{4}$ in. (cast)	2
P 9653	Tension Hook for Share, $\frac{5}{8}$ in. dia. $\times 7\frac{3}{4}$ in.	2
P 9654	Link for Tension Hook to Share, $1\frac{1}{2} \times 5/16 \times 3\frac{3}{8}$ in.	2
P 9656	"T" Head Rivet in Steel Share, $7/16 \times 1$ in.	2
P 9666	Share, less Bolts (steel, soft centre, 16 in., quick detachable)	2
P 9666½	Share, with Bolts (steel, soft centre, 16 in., quick detachable, see PE 9667½)	2
P 9667	Share, less Bolts (steel, solid, 16 in., quick detachable)	2
P 9667½	Share, with Bolts (steel, solid, 16 in., quick detachable, see PE 9666½)	2
P 9905	Thimble for Share, $\frac{3}{4}$ in. O.D., $\frac{3}{8}$ in. I.D. $\times 5/16$ in. (cast)	2
P 10201	Bracket for Share Tension Hook (cast)	2

Use Only Genuine Massey-Harris Repair Parts


MASSEY-HARRIS No. 27 GANG PLOW

List No.	DESCRIPTION OF PIECE	Quantity Used
P 10868	Thimble for Shock Shoe for Cast Share (cast) _____	1
P 12656	Washer for Brace to Mouldboard, 3/16 x 1 1/2 in. square, corrugated steel _____	2
P 14586	Kicker for Mouldboard, 3 1/2 x 1/4 x 15 1/4 in. _____	2
P 14982	Shock Shoe (for cast share), 1 1/2 x 3/8 x 7 3/4 in. _____	1

14 in. BOTTOM WITH GENERAL PURPOSE MOULDBOARD

ETP 45	Mouldboard, 14 in. _____	
ETP 46	Lower Brace to Frog (round hole) _____	
ETP 47	Lower Brace to Mouldboard (slotted hole) _____	
ETP 48	Upper Brace to Mouldboard _____	
ETP 65	Shock Absorber for Rear Bottom _____	
TEP 117	Landside _____	
CB 118	Pipe Pivot for Shock Absorber (1/2 in. rd. x 15/32 in.) _____	
6957	Shin Piece for Mouldboard (cast) _____	
6958	Filler between Mouldboard and Frog _____	
6962	Share (regular) (cast), 14 in. _____	
6967	Share (special for stoney ground) (cast), 14 in. _____	
7080	Frog _____	

NOTE—The word "Welded" means the part so described is WELDED to some other part or parts, and should not be ordered only as needed.

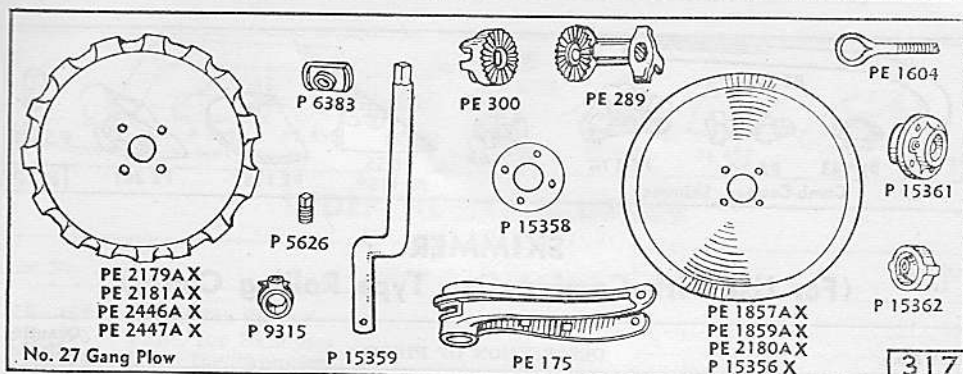


COMBINATION ROLLING COLTER (2 ARM STYLE)

1 1/4 in. Shank—15, 16, 17, 18 inch

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 175	Yoke, 2 arm, for 1 1/4 in. Shank	2
PE 289	Clasp for Colter Shank (inner)	2
PE 300	Clasp for Colter Shank (outer)	2
MP 1056	Oil Fitting for Colter, 1/2 in. Straight Screw Type	2
PE 1604	Eyebolt for Colter Shank, 1/2 in. dia., 5 in. centre of eye to end	2
PE 1604 1/2	Eyebolt for Colter Shank, complete, 1 PE 289, 1 PE 300, 1 PE 1604, 1 P 6383	2
PE 1857X	15 in. Blade and Bearings, 1 PE 1857AX, 1 P 15358, 1 P 15361	2
PE 1857AX	15 in. Blade, plain	2
PE 1858X	15 in. Colter, complete, less Clip, 1 PE 175, 1 MP 1056, 1 PE 1857X, 1 P 9315 1/2, 1 P 15359, 2 P 15362	2
PE 1859X	16 in. Blade and Bearing, 1 PE 1859AX, 1 P 15358, 1 P 15361	2
PE 1859AX	16 in. Blade, plain	2
PE 1860X	16 in. Colter, complete, less Clip, 1 PE 175, 1 MP 1056, 1 PE 1859X, 1 P 9315 1/2, 1 P 15359, 2 P 15362	2
PE 1861X	17 in. Colter, complete, less Clip, 1 PE 175, 1 MP 1056, 1 PE 2180X, 1 P 9315 1/2, 1 P 15359, 2 P 15362	2
PE 1862X	18 in. Colter, complete, less Clip, 1 PE 175, 1 MP 1056, 1 P 9315 1/2, 1 P 15357X, 1 P 15359, 2 P 15362	2
PE 2179X	18 in. Blade (notched), with Bearing, 1 PE 2179AX, 1 P 15358, 1 P 15361	2
PE 2179AX	18 in. Blade (notched, plain)	2
PE 2180X	17 in. Blade and Bearing, 1 PE 2180AX, 1 P 15358, 1 P 15361	2
PE 2180AX	17 in. Blade, plain	2
PE 2181X	17 in. Blade (notched), with Bearing, 1 PE 2181AX, 1 P 15358, 1 P 15361	2
PE 2181AX	17 in. Blade (notched, plain)	2
PE 2446X	15 in. Blade (notched) and Bearing, 1 PE 2446AX, 1 P 15358, 1 P 15361	2
PE 2446AX	15 in. Blade (notched, plain)	2
PE 2447X	16 in. Blade and Bearing, 1 PE 2447AX, 1 P 15358, 1 P 15361	2
PE 2447AX	16 in. Blade (notched, plain)	2
P 5626	Set Screw for Collar for Shank, 9/16 in. dia. x 1 in.	2
P 6383	Cast Washer for Channel Beam	2
P 9315	Cast Collar for Shank, 1 1/4 in. bore	2
P 9315 1/2	Cast Collar and Set Screw for Shank, 1 P 9315, 1 P 5626	2
P 15356X	18 in. Blade, plain	2
P 15357X	18 in. Blade and Bearing, 1 P 15356X, 1 P 15358, 1 P 15361	2
P 15358	Flange for Blade, 4 3/8 x 4 3/8 x 1/4 in.	2
P 15359	Shank for Colter, 1 1/4 in. rd. x 16 1/2 in.	2
P 15361	Centre Bearing or Double Cone (cast)	2
P 15362	Bearing for Outer Cone (cast)	4


In Ordering Repair Parts, Always State the Accessory or Unit—
Also Machine Used On—It Helps

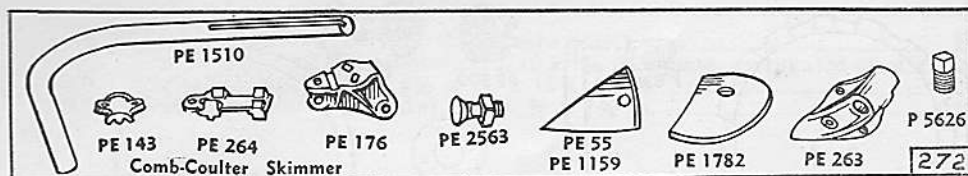

SKIMMER (For Use with Combination Type Rolling Colter)

List No.	DESCRIPTION OF PIECE	Quantity Used
PE 55	Skimmer Point (cast)	2
PE 143	Clamp for Skimmer Shank	2
PE 176	Bracket for Skimmer Shank	2
PE 263	Head for Skimmer	2
PE 263A	Head for Skimmer, complete with 1 PE 263, 1 PE 1159, 1 PE 1782 (steel point)	2
PE 263B	Head for Skimmer, complete with 1 PE 55, 7 PE 263, 1 PE 1782 (cast point)	2
PE 263 1/4	Skimmer, complete, 1 PE 143, 1 PE 176, 1 PE 263A, 1 PE 264, 1 PE 1510 (steel point)	2
PE 263 1/2	Skimmer, complete with 1 PE 143, 1 PE 176, 1 PE 263B, 1 PE 264, 1 PE 1510 (cast point)	2
PE 264	Seat for Skimmer Shank	2
PE 1159	Point for Skimmer (steel)	2
PE 1510	Shank for Skimmer, 1 in. dia. x 27 in.	2
PE 1782	Board for Skimmer (steel)	2
PE 2563	Bolt for Skimmer Board and Point to Head, 3/8 in. dia. x 1 1/8 in., No. 3 Head	6
P 5626	Set Screw in Head for Skimmer, 9/16 x 1 in.	2


TRASH SKIMMER FOR COMBINATION ROLLING COLTER (2 Arm Style)

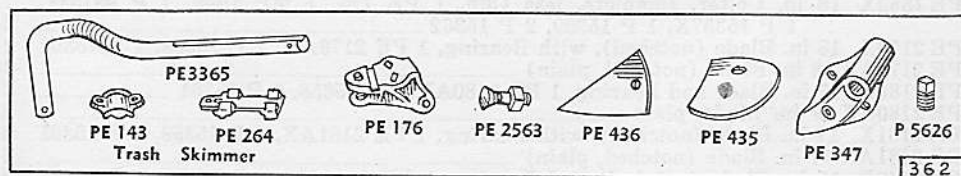

PE 143	Clamp for Shank	2
PE 176	Bracket for Shank	2
PE 264	Seat for Shank	2
PE 347	Head for Trash Skimmer, plain	2
PE 347B	Head for Trash Skimmer, complete, 1 PE 347, 1 PE 435, 1 PE 436, P 5626	2
PE 347 1/2	Trash Skimmer, complete with Shank and Bracket, 1 PE 143, 1 PE 176, 1 PE 264, 1 PE 347B, 1 PE 2928	2
PE 435	Board for Trash Skimmer	2
PE 436	Point for Trash Skimmer	2
PE 2563	Bolt for Skimmer Board and Point to Head, 3/8 in. dia. x 1 1/8 in., No. 3 Head	6
PE 2928	Shank for Skimmer, 1 in. dia. x 25 in., 1941-1943 (use PE 3365)	2
PE 3365	Shank for Skimmer, 1 in. dia. x 24 3/4 in., first used 1944 (will repair PE 2928)	2
P 5626	Set Screw for Head, 9/16 in. dia. x 1 in.	2

Use Only Genuine Massey-Harris Repair Parts

MASSEY-HARRIS No. 27 GANG PLOW

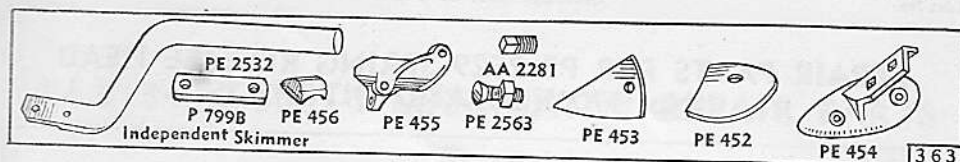

INDEPENDENT SKIMMER


List No.	DESCRIPTION OF PIECE	Quantity Used
PE 452	Board for Skimmer	2
PE 453	Point for Skimmer	2
PE 454	Head for Skimmer	2
PE 454 1/4	Skimmer, complete, less Clip, 1 PE 454 3/4, 1 AA 2281, 1 PE 2532	2
PE 454 1/2	Skimmer, complete, with Clip, 1 PE 454 3/4, 1 PE 455 1/2	2
PE 454 3/4	Skimmer Head, complete, 1 PE 452, 1 PE 453, 1 PE 454	2
PE 455	Clamp for Shank, outer	2
PE 455 1/2	Clip, complete, for Skimmer, 1 PE 455, 1 PE 456, 1 P 799B	2
PE 456	Clamp for Shank, inner	2
P 799B	Tie for Clamp, 1 1/2 x 1/2 x 6 in., 4 1/4 in. centres	2
P 1326	Bolt for Skimmer Board to Head, 3/8 in. dia. x 1 in., No. 3 Head	4
AA 2281	Set Screw for Clamp, 1/2 x 1 1/4 in.	2
PE 2532	Shank for Skimmer, 1 3/8 in. dia. x 23 1/4 in.	2
PE 2563	Bolt for Skimmer Point to Head, 3/8 in. dia. x 1 1/2 in., No. 3 Head	2

RUBBER TIRE WHEELS

MH 1037	Wheel, for Land or Furrow, 18 in. (1940 only, see MH 1056)	2
MH 1056	Wheel, for Land or Furrow, 16 in. (first used 1941, see MH 1037)	2
MP 5015	Rubber Tire, for Land and Furrow Wheel, 4 ply Implement Tire, 4.00 x 18, (1940 only, see F 5551)	2
MP 5017	Tube for Land and Furrow Wheels, 4.00 x 18 (1940 only, see F 5552)	2
F 5551	Rubber Tire for Land and Furrow Wheel, 5.50 x 16, 4 ply Implement (first used 1941, see MP 5015)	2
F 5552	Tube for Land and Furrow Wheels, 5.50 x 16 in. (first used 1941, see MP 5017)	2

REPAIR PARTS FOR PE 1887 SPRING RELEASE HEAD (No. 480 HOLLAND HITCH)


Used Part 1940 Only

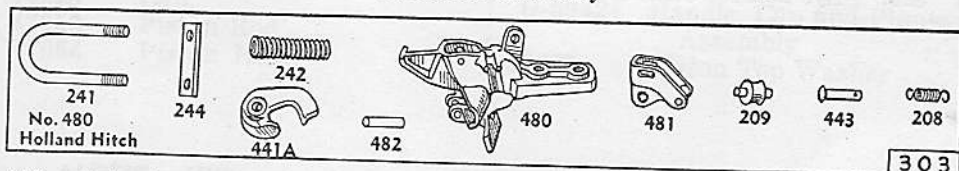

208	Extension Spring	2
209	Steel Concave Roller with Pin	2
241	"U" Bolt with Nuts, 1/2 stock	2
242	Compression Spring	2
244	Tie Strap for "U" Bolt	2
441A	Forged Draft Hook (Dog)	2
443	Support Pin for 481 with Cotter, 7/16 x 2 1/2 in.	2
480	Main Frame	2
481	Roller Housing with Roller	2
482	Draft Hook Pin, 5/8 in. x 1 13/16 in.	2

NOTE: When ordering Repairs for the above be sure to specify "HOLLAND HITCH."


REPAIR PARTS FOR PE 2529 SPRING RELEASE HEAD (No. 470 HOLLAND HITCH)

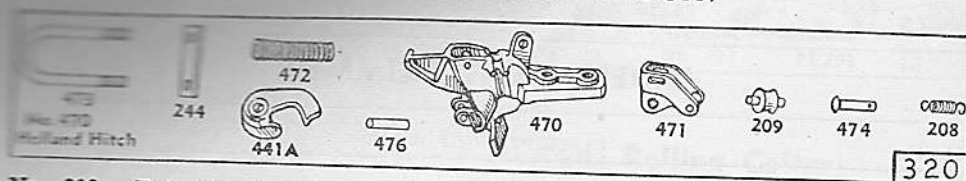

- | | | |
|----------|---|-------|
| No. 208 | Extension Spring | _____ |
| No. 209 | Steel Concave Roller with Pin | _____ |
| No. 244 | Tie Strap for "U" Bolt | _____ |
| No. 441A | Forged Draft Hook (Dog) | _____ |
| No. 470 | Main Frame | _____ |
| No. 471 | Roller Housing with Roller | _____ |
| No. 472 | Compression Spring, 9/16 in. I.D. x 4 in. | _____ |
| No. 473 | U-Bolt with Nuts, 7/16 in. Stock | _____ |
| No. 474 | Support Pin for No. 471 with Cotter, 7/16 x 2 1/8 in. | _____ |
| No. 476 | Draw Hook Pin, 5/8 x 1 1/8 in. | _____ |

NOTE: When ordering repairs for the above, be sure to specify "HOLLAND HITCH."

GRASS HOOK

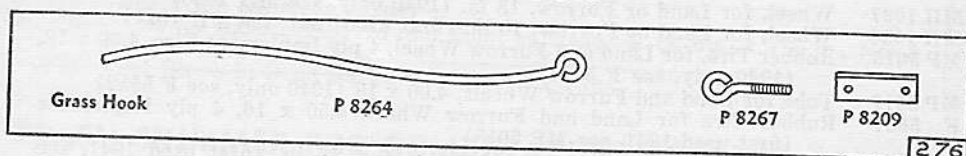

- | | | Quantity
Used |
|--------|---|------------------|
| P 8209 | Tie for Grass Hook, 1 1/2 x 3/16 x 3 1/2 in. centres | 2 |
| P 8264 | Grass Hook, plain, 5/8 in. dia. x 34 in. centre of eye to end | 2 |
| P 8265 | Grass Hook, complete, 1 P 8209, 1 P 8264, P 8267 and Washer | 2 |
| P 8267 | Eye Bolt for Grass Hook, 5/8 in. dia. x 3 1/2 in. | 2 |

NOTE—The word "Welded" means the part so described is WELDED to some other part or parts, and should not be ordered only as needed.

Part No.	Description
G-47055	Piston Assembly
47285	Plug
49017	Bottom Washer
G-49829	Nozzle and Piston Assembly
G-50152	Cylinder and Nozzle Assembly
G-50766	Cylinder and Cap
G-57053	Stem and Washer
57750	Leather Plunger
59416	Handle and Rod
G-59424	Handle, Cap and Plunger Assembly
59425	Piston Top Washer

NUMERICAL INDEX


No.	Page	No.	Page	No.	Page	No.	Page
PE 8	14	PE 347½	34	PE 559	24	PE1597	7
PE 10	14	PE 370	30	PE 560	24	PE1598	7
PE 23	6	PE 371	31	P 564	6	PE1599	7
ETP 45	32	PE 372	31	Z 578	6	PE1600	25
ETP 46	32	PE 374	18	PE 579	22, 23	PE1600½	25
ETP 47	32	PE 375	18	PE 580	22, 23	PE1601	26
ETP 48	32	PE 376	18	PE 581	18, 22, 23	PE1601½	26
PE 55	34	PE 377	18	PE 586	20	PE1602	26
PE 61	14	PE 430	20, 21	PE 587	20, 21	PE1602½	26
PE 62	14	PE 431	20, 21	PE 588	22, 23	PE1603	26
PE 62½	14	PE 432	20	PE 589	25	PE1604	33
ETP 65	32	PE 433	6	PE 590	25	PE1604½	33
PE 109	6	PE 434	6	PE 591	29	B 1614	7
PE 109½	6	PE 435	34	PE 592	29	PE1672	28
ETP117	32	PE 436	34	PE 593	18	PE1672½	28
CB 118	32	No. 441A	35, 36	PE 594	18	PE1673	28
P 121	25	No. 443	35	PE 595	20, 22	PE1673½	28
PE 131	28	PE 444	6	PE 648	6	PE1676	26
PE 143	34	PE 444½A	6	P 775	17, 25, 29, 30, 31	PE1677	26
PE 171	6	PE 452	35	P 799B	35	PE1686	28
PE 171¾	6	PE 453	35	PE 813	6	PE1693	28
PE 171¾A	6	PE 454	35	PE 827	6	PE1715	7
PE 172	6	PE 454¼	35	PE 828	6	PE1752	7
PE 175	33	PE 454½	35	P 876	11, 12, 13, 18, 20, 21	E 1755	7
PE 176	34	PE 454¾	35	PE 900	17	PE1770	7
PE 180	6	PE 455	35	PE 913	17	PE1782	34
No. 208	35, 36	PE 455½	35	MH1037	35	PE1800	7
No. 209	35, 36	PE 456	35	MP1056	6, 33	PE1801	7
PE 223A	6	No. 470	36	MH1056	35	PE1801½	7
PE 238	15	No. 471	36	PE1065	25	PE1802	7
PE 239	15	No. 472	36	PE1065½	25	PE1805	7
PE 240	15	No. 473	36	PE1066	25	PE1806	7
No. 241	15, 35	No. 474	36	PE1066½	25	PE1807	7
PE 241	15	No. 476	36	K 1124	6	PE1808	7
No. 242	35	No. 480	35	P 1156	11, 12, 13, 14, 16, 17, 18, 20, 21, 22, 23, 25, 26, 28, 29, 30, 31	PE1809	7
PE 242	15	No. 481	35	PE1159	34	PE1812	7
PE 243	15	No. 482	35	AT1234	6	PE1812½	7
No. 244	35, 36	PE 490	29	U 1262	6	PE1813	7
PE 263	34	PE 491	29	E 1307	6	PE1814	7
PE 263A	34	PE 520	6	P 1326	35	PE1817	7
PE 263B	34	PE 521	30	P 1330	14	PE1819	7
PE 263¼	34	PE 522	30	PE1407	6	PE1820	7
PE 263½	34	PE 523	31	PE1419	6	PE1823	7
PE 264	34	PE 524	31	PE1425	7	PE1826	7
PE 283	6	PE 539	30	PE1425¾	7	PE1829	7
PE 283½	6	PE 543	24	PE1428	7	PE1833	7
PE 289	33	PE 544	24	PE1429	7	PE1837	7
PE 296	6	PE 545	24	L 1458	7	PE1839	7
PE 297	6	PE 546	24	P 1467	22	PE1840	7
PE 298	6	PE 547	24	PE1510	34	PE1841	7
PE 298½	6	PE 548	24	P 1538	7	PE1843	7
PE 299	6	PE 549	24	P 1539	7	PE1844	7
PE 300	33	PE 550	24	P 1540	7	PE1845	7
PE 301	6	PE 551	24	PE1546	7	PE1847	7
PE 302	6	PE 552	24	PE1583	7	PE1848	8
PE 303	6	PE 553	24	PE1596	7	PE1849	8
PE 304	6	PE 554	24			PE1851	8
PE 305	6	PE 555	24			PE1852	8
PE 309	15	PE 556	24			PE1853	8
PE 347	34	PE 557	24			PE1855	8
PE 347B	34	PE 558	24			PE1856	8

INDEX



No.	Page	No.	Page	No.	Page	No.	Page
PE1857X	33	PE2189A	8	PE2575	31	PE2982	16
PE1857AX	33	PE2190	8	PE2575 1/2	31	PE2982 1/2	16
PE1858X	33	PE2194	8	PE2580	18	PE2983	17
PE1859X	33	PE2196	8	PE2670	24	PE2983 1/2	17
PE1859AX	33	PE2197	8	PE2671	24	P 3094	26, 28
PE1860X	33	PE2270	8	PE2672	24	P 3097	30, 31
PE1861X	33	AA2281	35	PE2673	24	GA3134	9
PE1862X	33	PE2297	8	PE2747	31	P 3162	9
PE1871	8	H 2330	8	PE2748	31	PE3180	9
PE1885	16, 17, 29, 30, 31	PE2379	8	PE2748 1/2	31	PE3181 1/4	9
PE1887	8	PE2390	8	No. 2758X	24	PE3181 1/2	9
PE1887 1/2	8	PE2403	18	No. 2765X	24	PE3182 1/4	9
PE1888	8	PE2403 1/2	18	PE2789	17	PE3182 1/2	9
PE1908	29	PE2404	18	PE2789 1/2	17	PE3183	9
PE1909	30, 31	PE2405	18	PE2850	21, 23	PE3184	9
PE1910	29, 30	PE2405 1/2	18	PE2850 1/2	21, 23	PE3253	9
PE1910 1/2	29, 30	PE2406	18	PE2851	20, 21, 22, 23	PE3365	34
PE1911	29, 30, 31	PE2406 1/2	18	PE2852	22, 23	PE3367	9
PE1911 1/2	29, 30, 31	PE2407	8	PE2852 1/2	22, 23	PE3368	9
PE1963 1/2	8	PE2407 1/2	9	PE2853	22, 23	PE3369	9
PE1965	8	PE2408	9	PE2853 1/2	22, 23	PE3588	9
PE1968C	8	J 2429	9	PE2854	22, 23	PE3588A	9
PE1969	8	PE2446X	33	PE2854 1/2	22, 23	PE3588 1/2	9
K 1972	8	PE2446AX	33	PE2855	22, 23	PE3589	9
PE1972	8	PE2447X	33	PE2855 1/2	22, 23	PE3590A	9
PE1976	8	PE2447AX	33	PE2856	18, 22, 23	J 3593	9
PE1981	8	PE2448	9	PE2857	18, 22, 23	PE3619 1/2	16, 17
PE1982	8	PE2448 1/2	9	PE2858	21, 23	PE3625	16, 17, 26, 28
PE1982 1/2	8	PE2448A	9	PE2858 1/2	21, 23	P 4214	12, 16, 17, 19, 22, 23, 26, 28, 30
PE2022C	8	PE2449	9	PE2859	21, 23	P 4214A	12, 16, 17, 26, 28, 29, 30, 31
PE2023	8	PE2452	9	PE2859 1/2	21, 23	P 4216	16, 17, 19, 26, 28, 29, 30, 31
PE2036	8	PE2453	9	PE2860	18	P 4217A	16, 26, 29, 30
PE2042	13	No. 2460X	24	PE2861	18	P 4218	16, 17, 26, 27, 28, 31
PE2045	15	PE2465	18	PE2861 1/2	18	P 4219	28
PE2045 1/2	15	PE2465 1/2	18	PE2862	18	P 4220	28
PE2046	15	PE2466	18	PE2862 1/2	18	P 4227	11, 12, 13, 16, 17, 19, 21, 22, 23, 26, 27, 28, 29, 30, 31
PE2047	15	PE2466 1/2	18	PE2863	18	P 4228	11, 12, 13, 19, 21
PE2048	15	PE2469	20	PE2863 1/2	19	P 4229	19, 22, 23
PE2049	15	PE2470 1/2	20	PE2864	19	P 4232	28
PE2052	15	PE2471	20	PE2864 1/2	19	P 4239	29, 30, 31
G 2089	8	PE2471 1/2	20	PE2867	20, 22	GB4430	10
PE2171	16	PE2472	20, 21	PE2867 1/2	20, 22	MP5015	35
PE2171 1/2	16	PE2473	20, 21, 22, 23	PE2868	20, 22	MP5017	35
PE2172 1/2	16, 17	PE2480	9	PE2870	19	PE5023	10
PE2173	16	PE2480 1/2	9	PE2870 1/2	19	PE5024	10
PE2173 1/2	16	J 2523	9	PE2871	19	PE5025	10
PE2174	16	PE2525	17	PE2871 1/2	19	PE5030	10
PE2174 1/2	16	PE2525 1/2	17	PE2872	20, 21	PE5068	10
PE2175	16	PE2526	17	PE2872 1/2	20, 21	P 5412	10
PE2175 1/2	16	PE2526 1/2	17	PE2873	20, 21	P 5501	16, 17, 26, 27, 28, 29, 30, 31
PE2176	16, 17	PE2529	9	PE2873 1/2	20, 21	F 5551	35
PE2176 1/2	16, 17	PE2529 1/4	9	PE2874	21		
PE2178	8	PE2529 1/2	9	PE2874 1/2	21		
PE2179X	33	PE2529 3/4	9	PE2875	21		
PE2179AX	33	PE2532	35	PE2875 1/2	21		
PE2180X	33	PE2555	14, 15	PE2877A	9		
PE2180AX	33	PE2556	14, 15	PE2880	21, 22		
Y 2181	8	PE2557	15	PE2880 1/4	21, 22		
PE2181X	33	PE2558	15	PE2880 1/2	21, 22		
PE2181AX	33	PE2563	34, 35	PE2881	21, 22		
PE2189	8	PE2574	28	PE2881 1/4	21, 22		
PE2189 1/2	8	PE2574 1/2	28	PE2881 1/2	21, 22		
				PE2928	34		

INDEX


No.	Page	No.	Page	No.	Page	No.	Page
F 5552	35	P 10682A	16, 17, 26, 27, 28	P 12656	16, 17, 21, 22, 23, 26, 27, 28, 30, 31, 32	P 14822	12
P 5580	14					P 14822½	12
P 5626	33, 34	P 10720	15	P 12996	28	P 14823	12
P 5630	11, 12, 13, 16, 17, 19, 21, 22, 23, 26, 27, 28, 29, 30, 31	P 10868	10, 11, 12, 13, 14, 15, 19, 21, 22, 23, 26, 27, 30, 31, 32	P 12996½	28	P 14825½	12
P 5827	11, 13, 19, 21, 22, 23, 26, 27, 29, 30, 31	No.11043X	24	P 12997	28	P 14826½	12
P 6383	10, 14, 16, 17, 19, 21, 22, 23, 26, 27, 28, 29, 30, 31, 33	No.11063X	24	P 12997½	28	P 14827	12
No.6957	32	P 11235	26	P 12998	28	P 14828	13
No.6958	32	P 11236	16, 17, 27	P 12998HM	28	P 14829	13
No.6962	32	P 11237	26	P 12998HM½	28	P 14830	13
No.6967	32	P 11238	16, 17, 27, 28	P 12999	28	P 14832	13
No.7080	32			P 13087	11	P 14832A	13
P 7143	30	No.11515X	24	P 13088	11	P 14968	13
P 7143½	30	P 11652	30	No.13093X	24	P 14968½	13
P 7144	30	P 11652½	30	P 13102	13	P 14982	12, 13, 14, 15, 19, 21, 22, 23, 26, 27, 30, 31, 32
P 7144½	30	P 11653	31	P 13102½	13	P 14986	13, 31
P 7156	31	P 11653½	31	P 13103	11	P 15101	30
P 7156½	31	P 11666	10	P 13103½	11	P 15101½	30
P 7158	30	P 11667	10	P 13159	10	P 15115	27
P 7689	12	P 12203	13	P 13237	10	P 15121	10
P 8058	30	P 12203½	13	P 13887A	10	P 15273	14
P 8209	36	P 12205	13	P 13903	13	P 15273½	14
P 8264	36	P 12205½	13	P 13905	11	P 15274	14
P 8265	36	P 12206	13	P 13906	11	P 15275	14
P 8267	36	P 12212	11	P 13906½	11	P 15276	14
P 9315	33	P 12216	11, 19	P 13907	11	P 15277	14
P 9315½	33	P 12225	11	P 13907½	11	P 15279	13, 14, 15
P 9400	10	P 12225½	11	P 13911	13	P 15288	14
P 9451	10	P 12226	11	P 14068	11	P 15295	14, 15
P 9651	30, 31	P 12226½	11	P 14162	28	P 15334	27
P 9653	30, 31	P 12227	11	P 14162½	28	P 15334½	27
P 9654	31	P 12227½	11	P 14242	11	P 15335	27
P 9656	16, 17, 19, 22, 23, 26, 27, 28, 30, 31	P 12228	11	P 14242½	11	P 15335½	27
P 9662	30	P 12228½	11	P 14243	11	P 15335HM	27
P 9662½	30	P 12303	14	P 14390	13	P 15335HM½	27
P 9663	30	No.12508X	24	P 14390½	13	P 15344	27, 28
P 9663½	30	P 12640	26	P 14393	13	P 15356X	33
P 9663X	30	P 12640A	26	P 14394	13	P 15357X	33
P 9663X½	30	P 12641	27	P 14394½	13	P 15358	33
P 9664	31	P 12641A	27	P 14395	13	P 15359	33
P 9664½	31	P 12641½	27	P 14395½	13	P 15361	33
P 9665	31	P 12642	26	P 14396	13	P 15362	33
P 9665½	31	P 12642½	26	P 14397	13	P 15363	27
P 9666	31	P 12643	27	P 14560	10	P 15363½	27
P 9666½	31	P 12643½	27	P 14561	10	P 15364	27
P 9667	31	P 12644	26	P 14562	10	P 15364½	27
P 9667½	31	P 12644½	26	P 14562A	10	P 15460	14
P 9904	31	P 12645	26	P 14573	12	P 15461	14
P 9905	16, 17, 26, 27, 28, 30, 31	P 12645½	26	P 14573½	12	P 15462	14, 15
P 9909	30	P 12645HM	26	P 14574	12	P 15463	14, 15
P 10201	31	P 12645HM½	26	P 14574½	12	P 15465	14
P 10204	17, 28, 30	P 12647	27	P 14575	12	P 15607	14, 15
P 10205	30	P 12647½	27	P 14586	12, 16, 17, 26, 27, 28, 30, 31, 32	P 15608	14, 15
P 10682	22, 23, 30	P 12648	27			No.19173X	24
		P 12648½	27	P 14590	12	No.19175X	24
		P 12650	27	P 14590½	12	No.19177X	24
		P 12650½	27	P 14591	26	No.19179X	24
		P 12652	27	P 14591½	26	No.19193X	24
		P 12652½	27	P 14592	27	No.19197X	24
		P 12654	26	P 14592½	27	No.19205X	24
		P 12655	27, 28	P 14821	12		

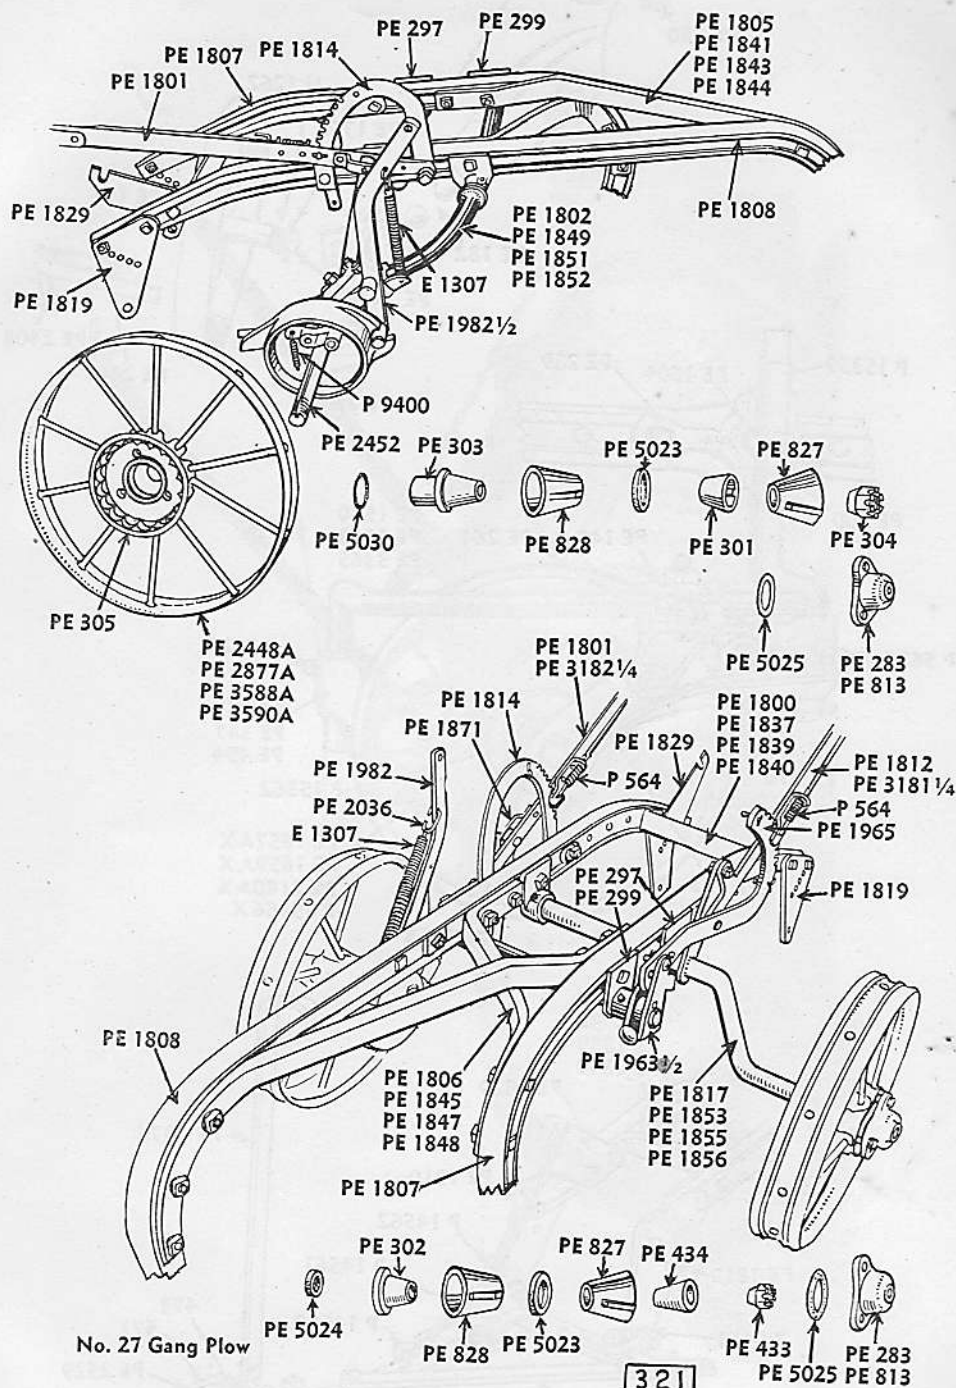

Do Not Order From Illustrations Only. Always Refer to Descriptive List.

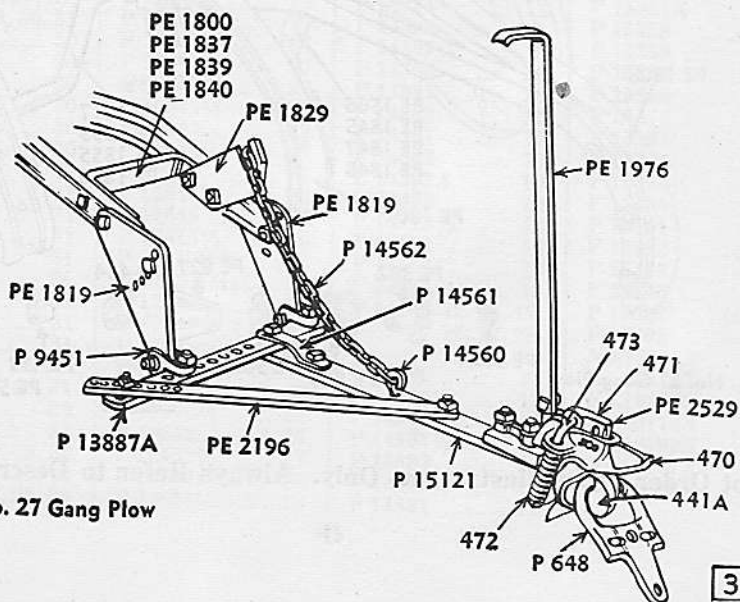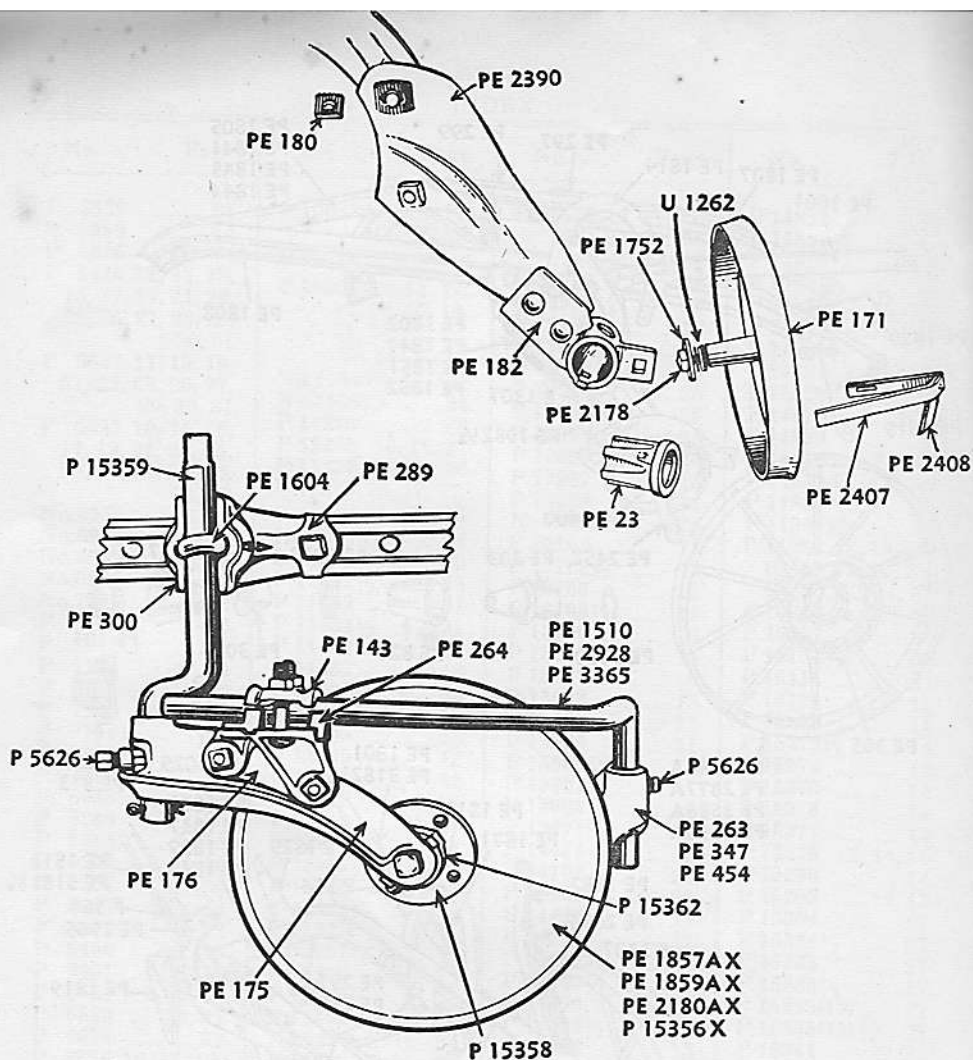

No. 27 Gang Plow

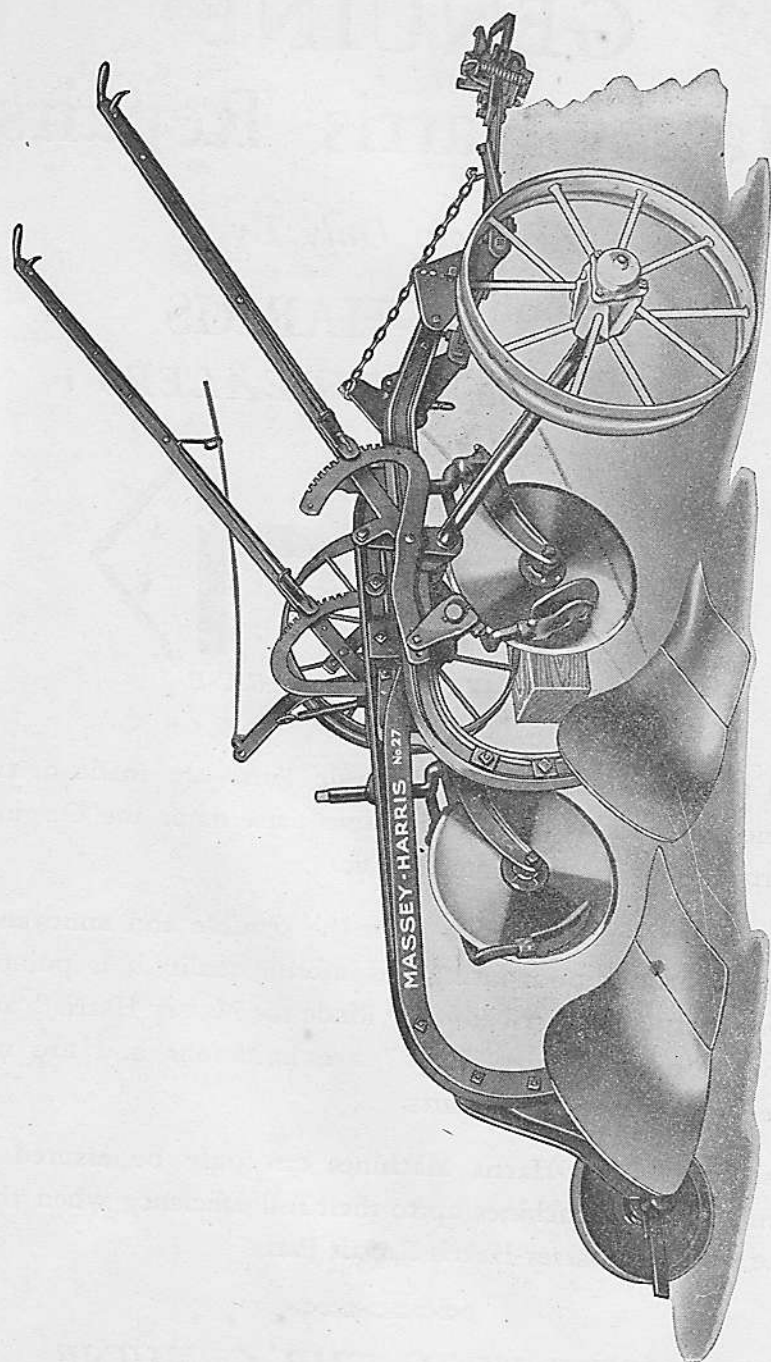

GENUINE Massey-Harris Repairs

Are Sold Only By

MASSEY-HARRIS
AGENTS and DEALERS



THE MARK OF THE GENUINE

All Genuine Massey-Harris Repair Parts are made of the same materials and from the same patterns as the Original Parts. They are guaranteed to fit.

To protect our customers from the trouble and annoyance caused through poor fitting and inferior quality it is pointed out that parts described as "Made for Massey-Harris" and "Made to fit Massey-Harris" are imitations and are not Genuine Massey-Harris Parts.

Users of Massey-Harris Machines can only be assured of bringing their machines up to their full efficiency when they use Genuine Massey-Harris Repair Parts.



INSIST UPON THE GENUINE